

GENERAL INSTALLATION GUIDE

# Standard installation for field assembly



Your vision. Our purpose.

# ONEDEK®

INSULATED ROOF DECK



Chapman Properties | Imperial, PA



Treehouse Almonds | Earlimart, CA



Bee Sweet | Fowler, CA

# Contents

## 1. HANDLING INSTRUCTIONS

1.1 Arrival on site	3
1.2 Unloading with forklift	3
1.3 Unloading with a crane	3
1.4 Manually unloading	6

## 2. STORAGE INSTRUCTIONS

2.1 Site storage	7
2.2 Accessories and auxiliary items	8

## 3. INSTALLATION INSTRUCTIONS

3.1 Supporting steel	9
3.2 Protective plastic film	9
3.3 Accessories, trims, sealants	10
3.4 Panel cutting procedures	11
3.5 Roof panel installation sequence	11
3.6 Installation procedure	12
3.7 Concealed clip fastening	12
3.8 Diaphragm fastening	13
3.9 Roof panel end joint fastening	17

## 4. MISCELLANEOUS INFORMATION

4.1 Miscellaneous information	20
4.2 Exposure to heat or flame	20

## 5. PANEL MAINTENANCE INSTRUCTIONS

5.1 Cleaning panels	21
5.2 Membrane maintenance	21

## 6. ONEDEK® TAPERED INSULATION PREPARATION

6.1 Tapered Insulation Preparation	22
6.2 Tapered Insulation Installation	22
6.3 Mechanically Attached Tapered Insulation Systems	22
6.4 Fully Adhered Tapered Insulation Systems	24
6.5 Tapered Insulation Protection	24

## 7. ONEDEK MEMBRANE PREPARATION

7.1 Membrane preparation	25
7.2 Membrane welds and seams	25
7.3 Membrane adhesives	26
7.4 Membrane flashing	27
7.5 Membrane installation	27

## 8. MECHANICALLY ATTACHED SYSTEMS

8.1 Infield zone installation	28
8.2 Perimeter zone installation	28
8.3 Corner zone installation	29

## 9. FULLY ADHERED SYSTEMS

9.1 Adhesive application rate	32
-------------------------------	----

## 10. PENETRATIONS AND MEMBRANE REPAIR

10.1 Outside corner installation	33
10.2 Inside corner installation	35
10.3 Membrane curb flashing	38
10.4 Canted base curb flashing	40
10.5 Vent pipe flashing	43
10.6 Scupper Installation & Flashing	45
10.7 Membrane repair	46
10.8 Membrane maintenance	46

## DISCLAIMER

All Weather Insulated Panels (AWIP) shall not be responsible for any damage and injuries incurred while handling and/or installing the panels, trims and accessories. In-site personnel shall follow the appropriate safety protocols as determined by the relevant governing bodies.

Please refer to project-specific details as All Weather Insulated Panels has provided shop/erection drawings. Shop drawings prepared by AWIP show fastening details, panel layouts, wall elevations, roof plans and/or ceiling plans only and reflect the design criteria listed on the cover sheet. The shop drawings are intended to be a guide for minimum acceptable installation procedures and to indicate the quantity, size and material specifications of products furnished by AWIP for the referenced project. They do not replace or supplant specifications or notes on structural drawings. It is the customer's responsibility to verify and approve the design loads shown on the AWIP shop drawings and/or provide AWIP with any additional design loads that need to be taken into consideration. AWIP is only responsible for showing and providing materials that are included in the sales order acknowledgement. The materials furnished by AWIP have been approved for the purposes shown in the AWIP shop drawings. Materials not provided by AWIP may be shown in the AWIP shop drawings for informational or clarity purposes. The AWIP shop drawings are based off information provided to the AWIP detailing team. Details and dimensions must be verified by the customer. AWIP shall not be responsible or liable for incorrect dimensions or conditions after signed approved shop drawings are returned.

Unless noted otherwise, this project has been designed based on ambient building conditions and not as a cooler or freezer building. If this is not the case, please notify your AWIP project manager immediately and provide the interior temperature(s).

# Handling Instructions

## 1.1 ARRIVAL ON SITE

All Weather Insulated Panels are carefully bundled and stretch-wrapped to prevent damage during shipping. The transportation company is responsible for delivering these components undamaged. When shipment is received, check each item against the bill of lading for quantity, length, transit damage, etc. If shortage or damage is found, make sure a notation of it is made on the bill of lading and signed by the driver. Customer must notify to AWIP to begin the claim process.

Freight claims should be handled directly with the freight company. If transportation arranged by AWIP, place a note on the BOL and return to AWIP. Then please notify your AWIP project manager.

## 1.2 UNLOADING WITH A FORKLIFT

All panel bundles are reinforced with bottom sheet(s) of OSB at lifting points to prevent damage during handling. Lift bundles one at a time with a forklift. See Figure 1A for recommended lifting point locations. Long-length bundles (36'-0" or longer) will have four or more lifting points (see Figure 1B).

Fork blades must be set to not less than 48" wide.

**NOTE:** Ensure that forks are between the 3" foam stickers at the bottom of each bundle.

## 1.3 UNLOADING WITH A CRANE

When moving bundle(s) with a crane, use an appropriate combination of spreader bars, slings, and anti-pinch boards to safely distribute the bundle's weight. When bundles are longer than 15'-0", it is suggested that a properly designed and fabricated lifting beam/spreader bar is used.

**NOTE:** Unloading with a crane is recommended for any bundles over 50'-0" long.

Please notify All Weather Insulated Panels of any order discrepancies within 72 hours of delivery. Otherwise, All Weather Insulated Panels will conclude that the order was completed successfully.

A panel packing list is provided for each bundle and is located within a sleeve adhered to the side wrapping. Please use this document to check for bundle information.

All Weather Insulated Panels will generally arrive in large, stretch-wrapped bundles on flat bed trailers. Consequently, the bundles should be off-loaded by means of crane system or forklift.

Do not over-engage forks when lifting a bundle as doing so may damage the bundle(s) behind it. 6" foam blocks may be placed on the back (upright) leg of the forks to soften the contact between the forks and the bundle.

**NOTE:** Extreme care should be taken to avoid bumping the panels when lifting and maneuvering.

Anti-pinch boards should be long enough to swallow the entire width of the bundle and be placed at the top and bottom of the bundle. Use one set (top and bottom) of anti-pinch boards per sling.

The size and quantity of the spreader bar(s) may vary depending on the length and weight of the bundle(s). Long-length bundles (36'-0" or longer) will have four or more lifting points (see figure 2B). Only lift one bundle at a time.



# Handling Instructions


**FIGURE 1A: "STANDARD-LENGTH" BUNDLES (10'-0" TO 36'-0")**

Use one forklift to lift bundles at the lift point sections.





**FIGURE 1B: "LONG-LENGTH" BUNDLES (36'-0" OR LONGER)**

When handling long-length bundles, be careful not to position your lift at the center of the bundles as this may damage the panels. Use two forklifts (or crane straps) to lift the bundle at the lift point sections.

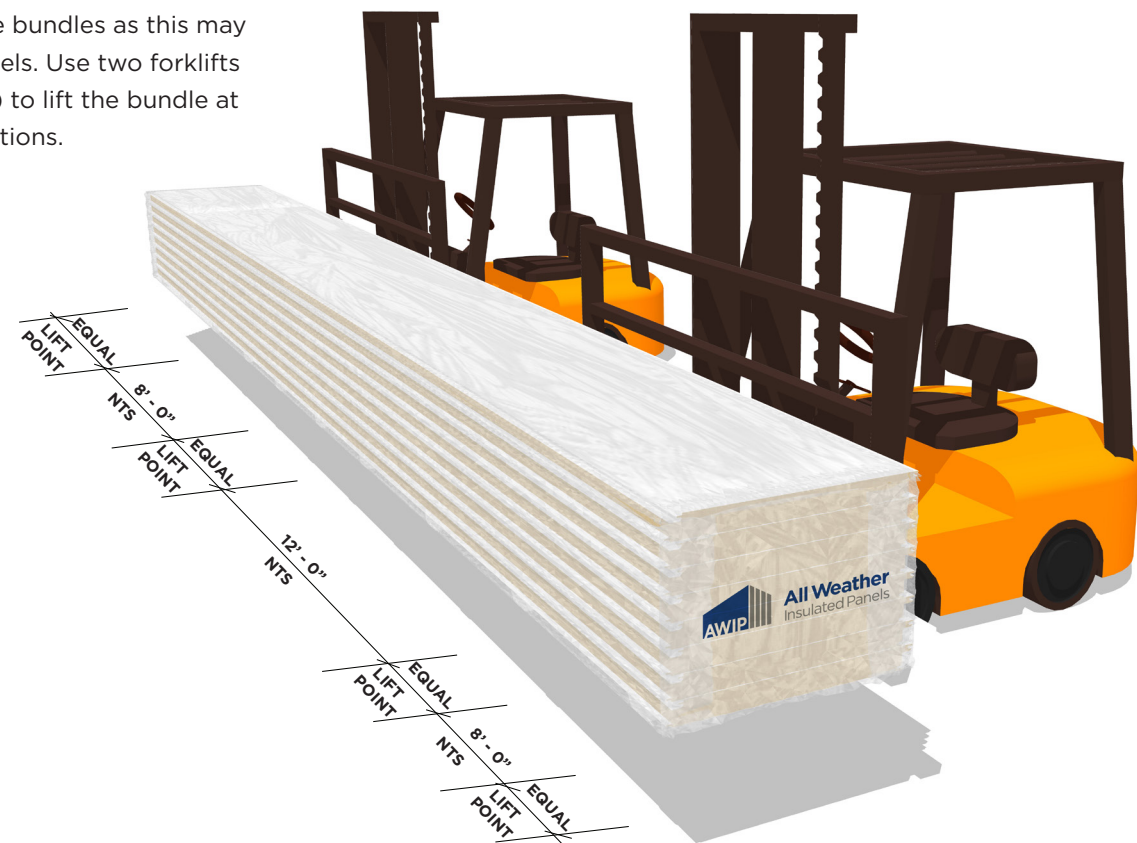

# Handling Instructions

**FIGURE 2A: "STANDARD-LENGTH" BUNDLES (10'-0" TO 36'-0")**

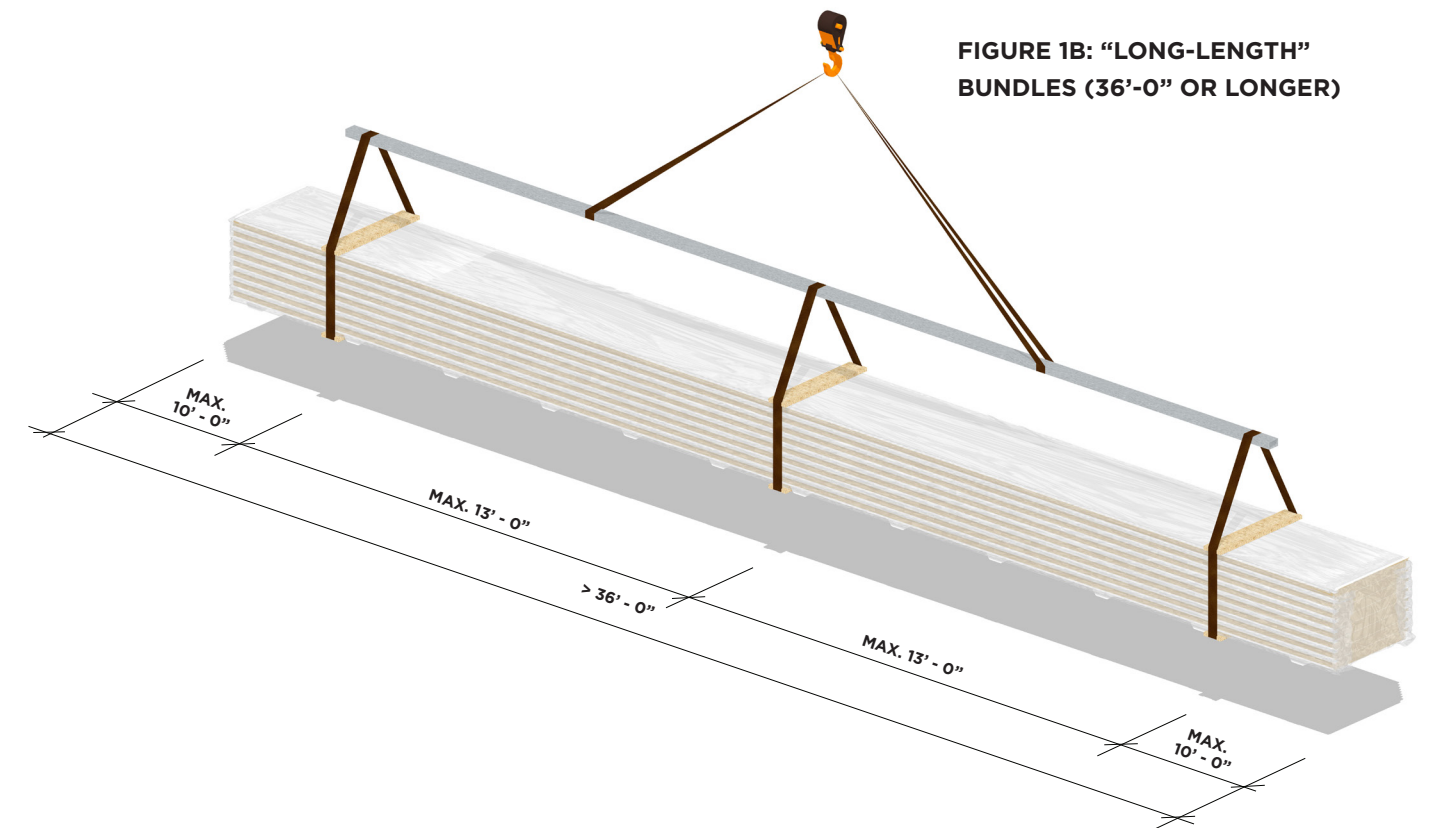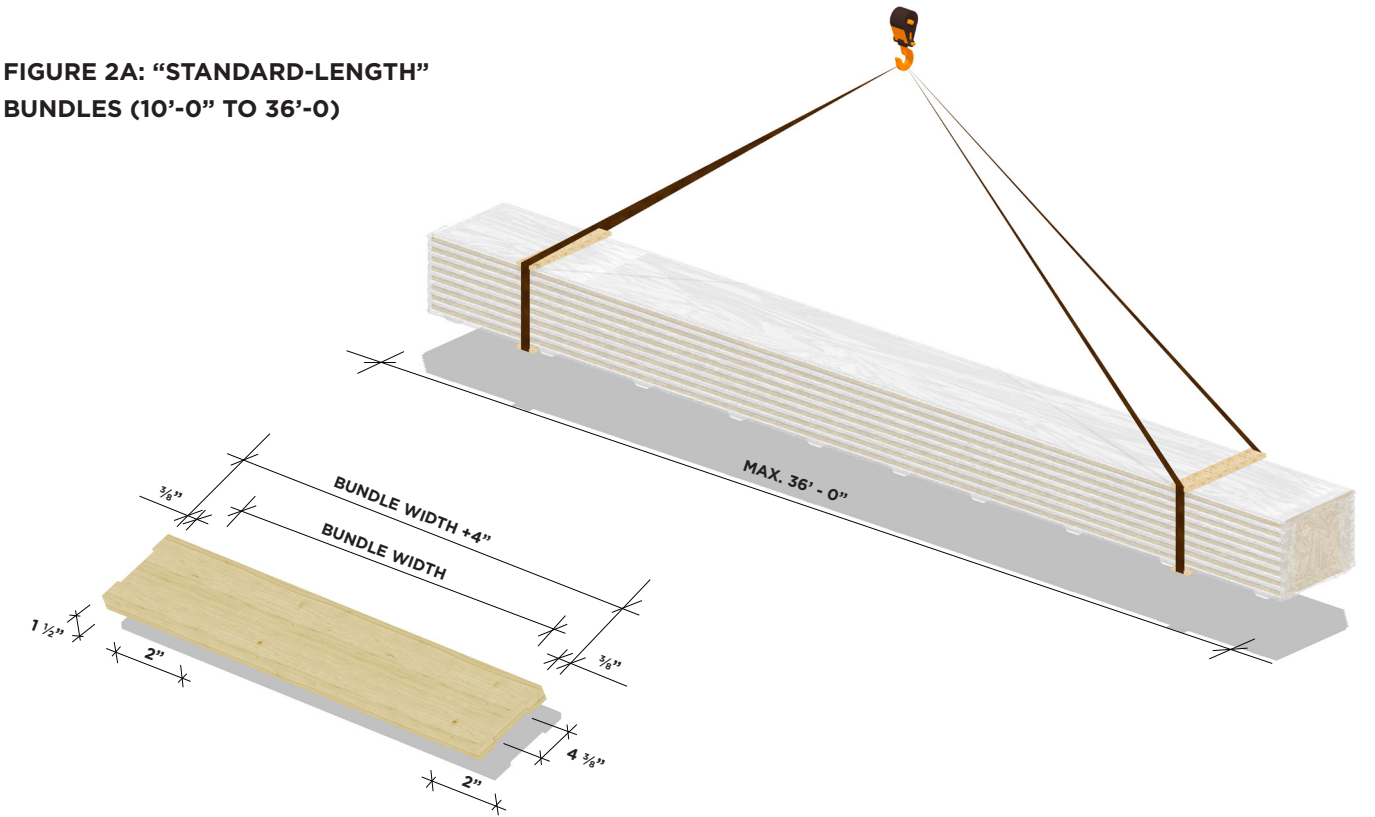

**FIGURE 1B: "LONG-LENGTH" BUNDLES (36'-0" OR LONGER)**

# Handling Instructions

## 1.4 MANUALLY UNLOADING

On small projects, unloading of the panels may be done by hand.

**NOTE:** Special care should be taken when handling panels. Always lift the panels when removing from a bundle, never drag them.

Avoid carrying the panel from flat orientation, especially long panels which are more prone to bending damage. If necessary, use more than two persons to evenly support the panel.

To prevent joint damage, never lift the panel from the flat position by the side joint or the overlapping rib. Doing so may cause the metal and foam to separate.

**NOTE:** All personnel performing these tasks must wear proper clothing and protective equipment at all times.

# Storage Instructions

## 2.1 SITE STORAGE

If the panels are to be used immediately, the bundles should be placed at the pre-planned locations around the perimeter or the building, as close as possible to the corresponding work areas. Place bundles as far practical from the site to avoid possible damage from later site maneuvering or undue handling.

Ideally, the bundles should be stored under a temporary shelter with the plastic removed from the top and sides of the bundle. Site storage time should be minimized.

If the bundles cannot be stored in a covered location, it is necessary to cut the outside plastic wrapping and arrange the bundles such that are inclined at a (minimum) 1:12 slope so that the water does not accumulate, and moisture build up between panels is avoided. The continuous cut should be made along the width of the bundle; cut 1'-0" slits 5'-0" o/c along the length of the bundle (see figure 3). Do not store for longer than 30 days. Moisture between panels can cause corrosion and oxidation of painted surfaces referred to as "wet stack".

**NOTE:** If temporary shelter is not available, our panels are packaged with plastic stretch wrap and expanded polystyrene board. It is, however, a requirement that additional protection be provided to protect the panels from wet weather conditions during transit and at the jobsite. Standing water on stored and/or bundled skids may cause damage to the panel finish and is not acceptable.

**NOTE:** Do not stand panels on edge of joinery or saw-cut edge. Never store or handle panels in a horizontal position.

Bundles should be stacked no more than two high. The foam stickers on the upper bundle should be located in line with the foam stickers on the lower bundle (see Figure 3).

Bundles should be firmly tied or weighted down when broken open for use.

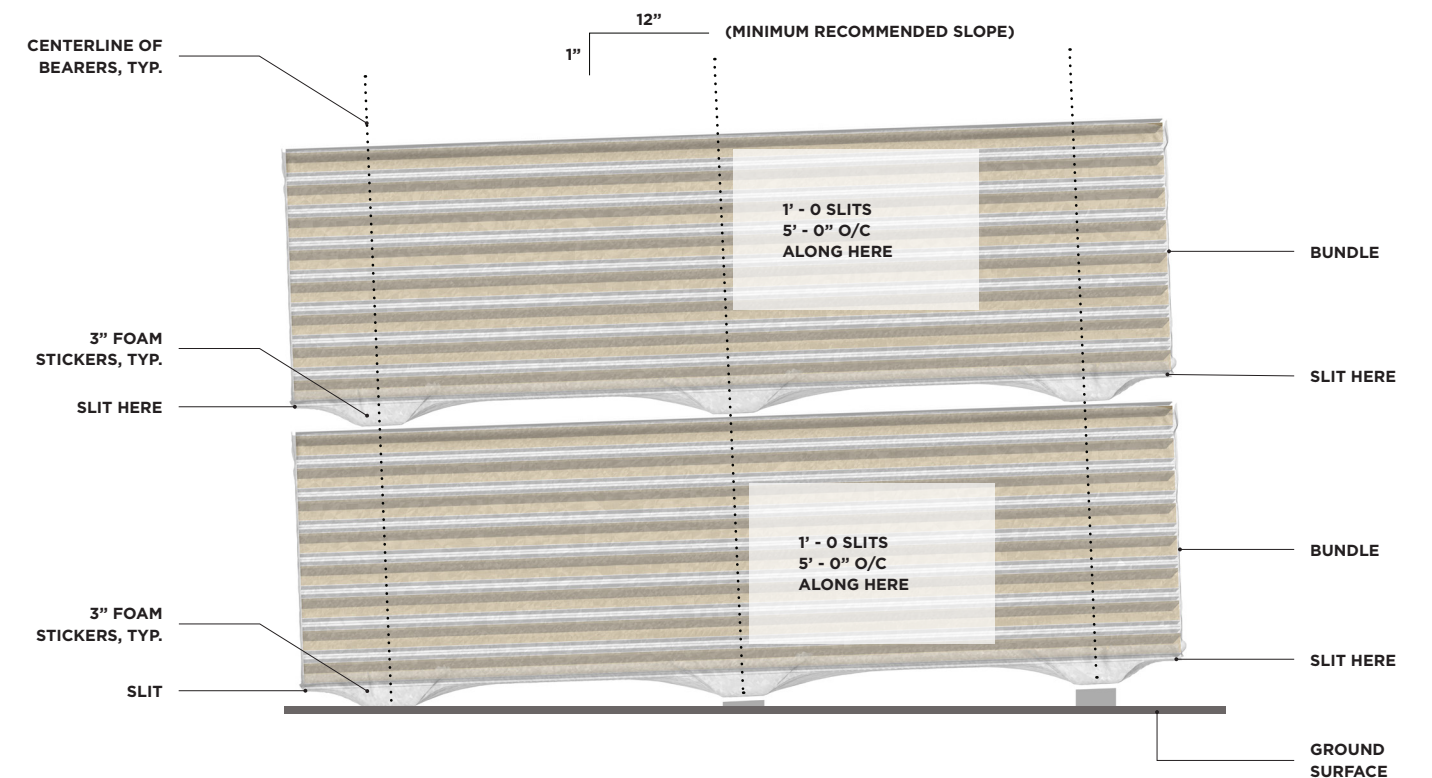


FIGURE 3: PROPER BUNDLE STORAGE



# Storage Instructions

## 2.2 ACCESSORIES AND AUXILIARY ITEMS

Due care should be afforded to the handling and storage of small items (e.g. flashings, fasteners, sealants, etc.) that arrive on site for inclusion in the work.

Cover all pallet crates and/or boxes to protect materials from weather but allow for adequate ventilation to prevent collection of condensation.

# Installation Instructions

## 3.1 SUPPORTING STEEL

For quality panel installation, the panel contractor shall examine the alignment of the support steel before installation of the insulated roof deck. The steel shall be aligned to per the tolerances established in the AISC Code of Standard Practice, section 7, and The Supplement Modification Control Section 7.11.3, adjustable items. The maximum deviation of steel alignment should be limited to -0, + 3/16" from the control with and 1/8" maximum change in deviation for any member of any 10'-0" run of panel.

Any variance(s) from these tolerances can affect both performance and aesthetics and must be reported to the architect and general contractor and corrected by the general contractor or accepted, in writing, by the architect before panel installation proceeds.

---

## 3.2 PROTECTIVE PLASTIC FILM

OneDek insulated roof deck panels and metal trims have a temporary protective plastic film. This plastic film helps prevent damage during shipping and handling.

This protective plastic film is not to be removed until panels and metal trims are ready for erection.

Protective plastic film shall not be exposed to direct sun for more than 48 hours as this may cause the plastic film to bond to the metal panel face and may become more difficult to remove. Additionally, prolonged exposure to temperatures above 80 °F is not recommended as this may cause the peel coat to leave an adhesive residue on the panel facing(s).

The face(s) of all support members to which the panel is attached must be in the same plane, flat, and free of obstructions such as weld marks, bolts, or rivet heads. Installation of the panels should proceed only if the alignment of support members meets the tolerances established in the contract documents.

---


**NOTE:** See Section 2.0 for instructions on proper storage.

The best way to remove the protective plastic film is to start at a panel corner and peel off at a 45° an angle (see *Figure 4*).

The plastic film must be removed from both panel faces and metal trim (if applicable).

Any residue on the metal face(s) from the plastic film can be removed using a soft cloth and water. It may be necessary to use a citrus-based cleaning solution added to the water in a sufficient dilution ratio to effect complete removal of the adhesive.

# Installation Instructions

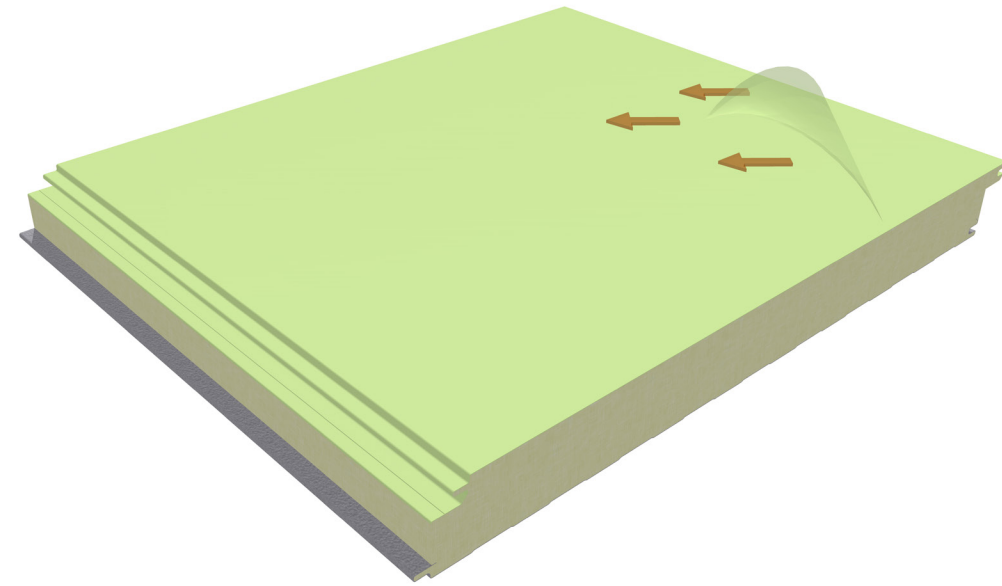

**FIGURE 4: PLASTIC FILM REMOVAL**

### 3.3 ACCESSORIES, TRIMS, SEALANTS, ETC.

Extreme care should be taken when unloading and storing the fasteners, sealants, etc. It is important to guard against damage or misplacement of the accessories.

All accessories must be stored in a covered location on the jobsite and not exposed to the elements.

# Installation Instructions

### 3.4 PANEL CUTTING PROCEDURES

Panels may be cut prior to installation or cut-in-place. All Weather Insulated Panels recommends cutting the panels prior to installation to minimize panel damage and to ensure a good fit.

All Weather Insulated Panels recommends using a circular saw with an 8" diameter, 40 tooth carbide blade.

To perform a good cut, follow steps 1 through 4 shown below. If the panel thickness is greater than the saw's blade radius, cutting should be done in two steps, cutting one side at a time; follow steps 1 through 6.

1. Measure the area to cut and mark a chalk line on the panel surface.
2. Use adhesive tape on both sides of the cutting line to protect panel surface.
3. Recheck measurements and proceed with cutting operation.

4. Clean off any metal chips left on panel after cutting procedure. Any metal chips on the foam can be removed by hand.

5. If necessary, turn panel over and follow steps 1 through 4 for the other side of the panel.


6. File and sand off any burrs on the metal after cutting to prevent damage to the membrane. The panel is now ready for installation. The installer must consider the application of a continuous bead of sealant and, if necessary, the cutting of thermal bb breaks prior to installation; such tasks shall be done on the ground.

**NOTE:** Do not use a reciprocating saw as it may delaminate the panels by tearing the facings from the foam core, especially in colder climate conditions. Additionally, friction between the cutting blade and the panel creates heat and may damage the painted surface of the panel.

### 3.5 ROOF PANEL INSTALLATION SEQUENCE

Minimum roof slope of 1/4: 12 required.

Reference project drawings for diaphragm or non-diaphragm fastening patterns and ensure correct fastening patterns is used during installation.

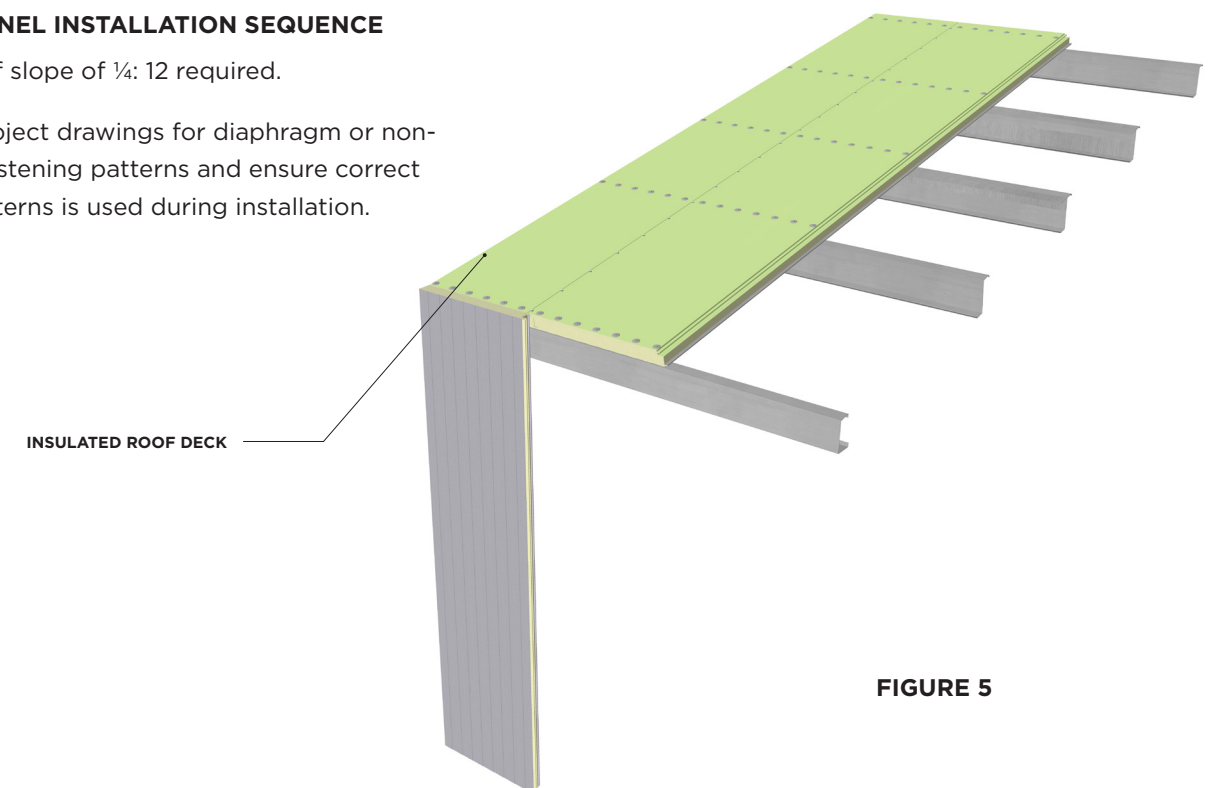

**FIGURE 5**



# Installation Instructions

## 3.6 INSTALLATION PROCEDURE

As each panel is removed from the bundle, the male and female edges should be visually examined, and overspill of insulation should be carefully removed.

Cut the first RD1/RD1-M panel to be installed (rake edge) along the length to remove panel joint.

The insulated roof deck should be laid flush with the face of the wall panel as shown on the AWIP shop drawings. It is important that the first tier of panels is laid true to line, properly lined with a string to ensure a true and neat run.

The starter panel should be fastened along the rake supporting member in the required spacing as shown in the AWIP shop drawings.

Adequate caulking and sealing of the panels and trims is the sole responsibility of the installing contractor (customer). All Weather Insulated Panels highly advises pre-installation quality control testing to be completed on-site prior to commencing with installation to ensure a complete sealant bridge from metal to metal.

## 3.7 CONCEALED CLIP FASTENING

Insert fastener through clip and tighten down until clip and fastener assembly are snug. Continue to install concealed clip assembly at each steel roof support along the length of the panel. Fastener requirements are based on given design loads. Concealed clip only fastening does not provide any diaphragm resistance.

Once caulking has been placed and inspected, the next panel should be placed as soon as possible. Ensure panels are installed as tight as possible to allow tongue and groove joint to fully engage.

Square each panel before installing fasteners. Prior to installation, panels may need to be placed in a shaded area to prevent excessive thermal bow which may hinder panel engagement.

Panels are to be fastened per the roof panel fastening schedule and calculations noted on the AWIP shop drawings.

# Installation Instructions

## 3.8 DIAPHRAGM FASTENING

If diaphragm fastening requires the use of concealed clips, see Concealed Clip Fastening. The entire roof may be installed using the concealed clip fastening method to close in the building and create a walkable surface prior to installing the through fasteners and stitch fasteners. Ensure the gap between the topside panel joint is no greater than 4 mm during installation.

**OPTION:** Even if the project specific diaphragm fastening pattern doesn't require concealed clips, concealed clip fastening may be used to close in the building quicker to allow other trades to operate inside the building. The through fastener and stitch fastener steps may be performed afterwards.

Use a chalk line to appropriately position fastening locations. Set the RP-01 roof deck plate in place and insert the fastener through the RP-01. Install RP-01 and fastener assembly across the width of the panels in the project specified spacing. Continue to install RP-01 and fastener assemblies at each steel roof support.

Ensure the gap between topside panel joint is no greater than 4 mm. Inspect engagement at panel end and use a chalk line to set fastening location 11 mm from edge of panel joint. (See Figure 6).


Install stitch fasteners along the panel seams in the project specified spacing.

**FIGURE 6: STANDARD RD1/RD1-M JOINT DETAIL FOR DIAPHRAGM**

Insulated roof deck panels are to be fastened per shop drawing details and calculated fastening schedule provided on All Weather Insulated Panels shop drawings. Use a standard 0 to 800 RPM variable speed screw gun with 4 to 5 AMPS and a positive clutch or depth locating nose to drive fasteners. Do not use impact type guns. Do not over-tighten.


The fastening pattern will depend on the panel thickness, span, substrate, and design loads. Consult your All Weather Insulated Panels representative or the factory for allowable panel and fastener design loads.

After drilling or cutting panels, always remove metal chips and foam dust that has fallen on panels or trims.

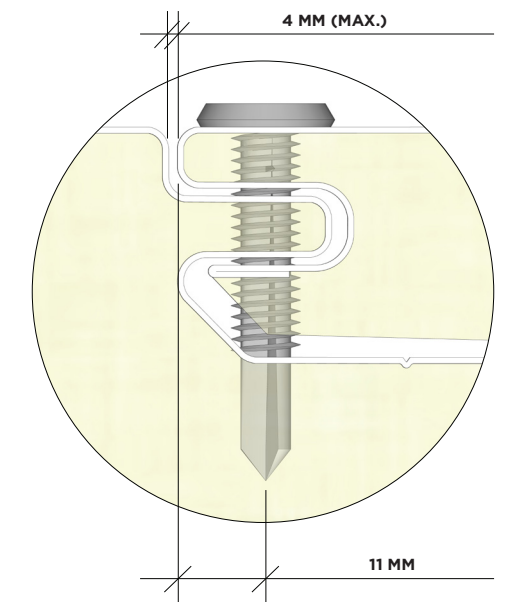

# Installation Instructions


**NOTE:** For skew-cut conditions, refer to RD1/RD1-M diaphragm fastening system (skew-cut).

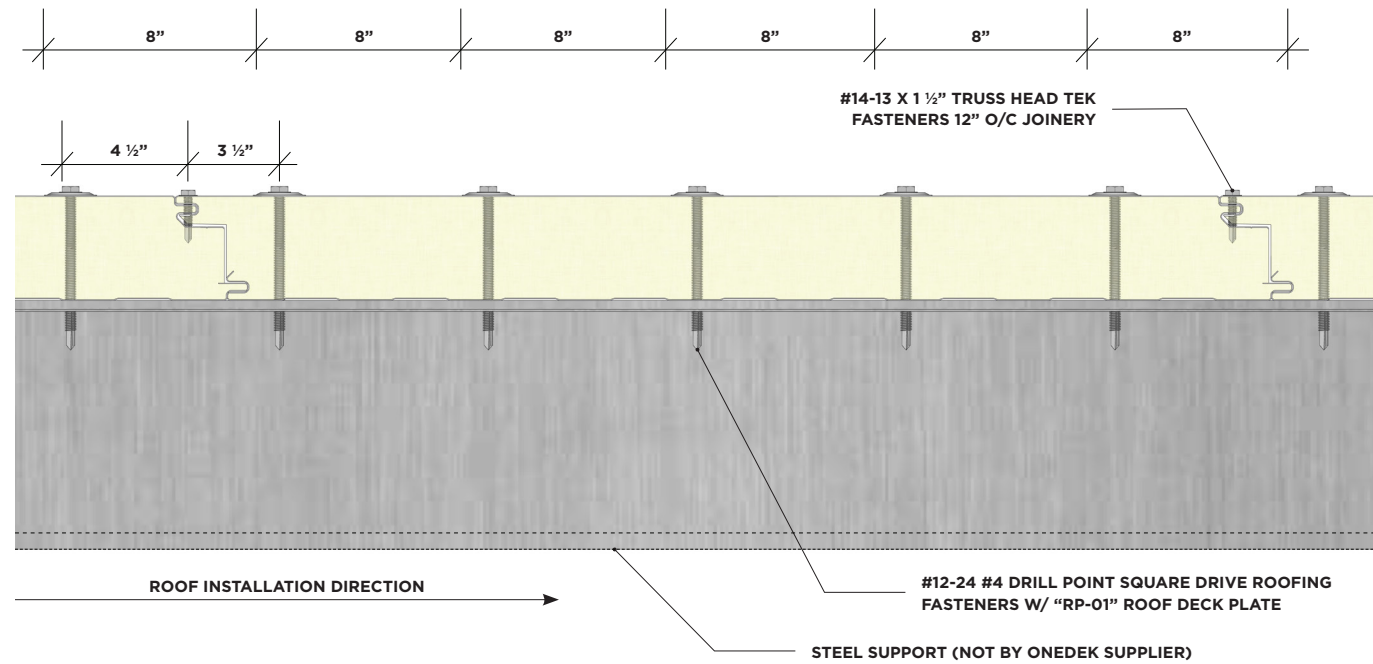

**FIGURE 7: RD1/RD1-M DIAPHRAGM FASTENING SYSTEM (40/5-12)  
(SECTION VIEW)**


# Installation Instructions

**NOTE:** For skew-cut conditions, refer to RD1/RD1-M diaphragm fastening system (skew-cut).

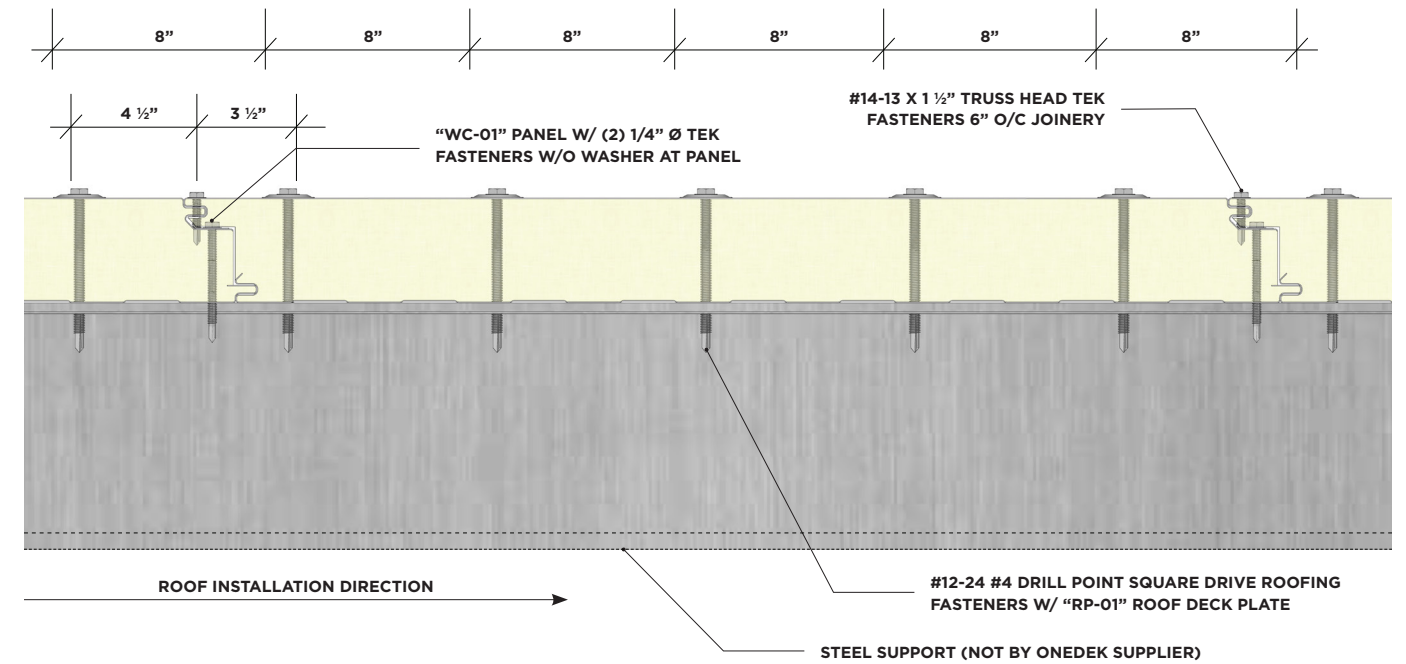


**FIGURE 9: RD1/RD1-M DIAPHRAGM FASTENING SYSTEM (40/7-6)  
(SECTION VIEW)**

**NOTE:** Fastening schedule may vary depending on specific application.

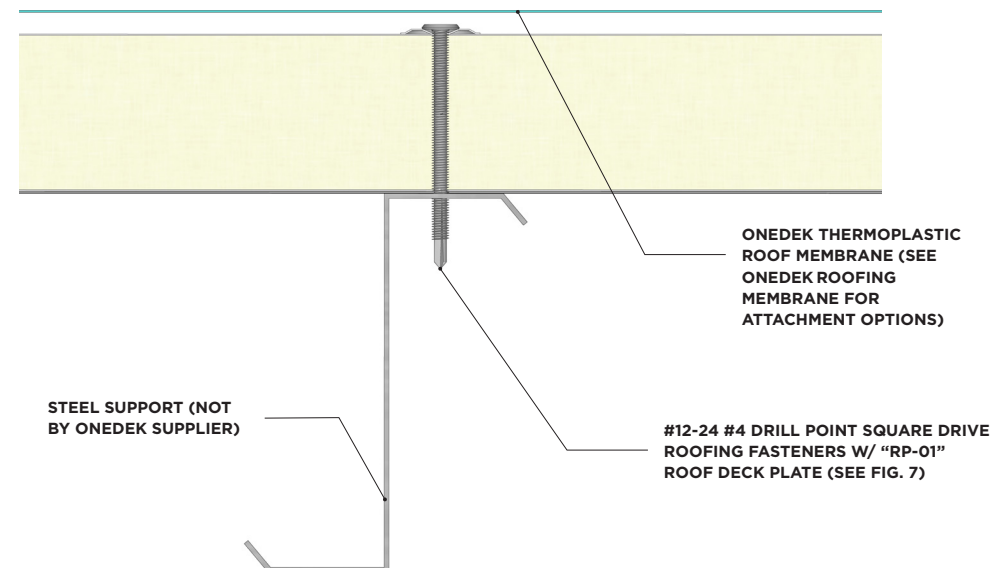

**FIGURE 8: INTERMEDIATE RD1/RD1-M ROOF FASTENING  
(SECTION VIEW)**

**NOTE:** Fastening schedule may vary depending on specific application.

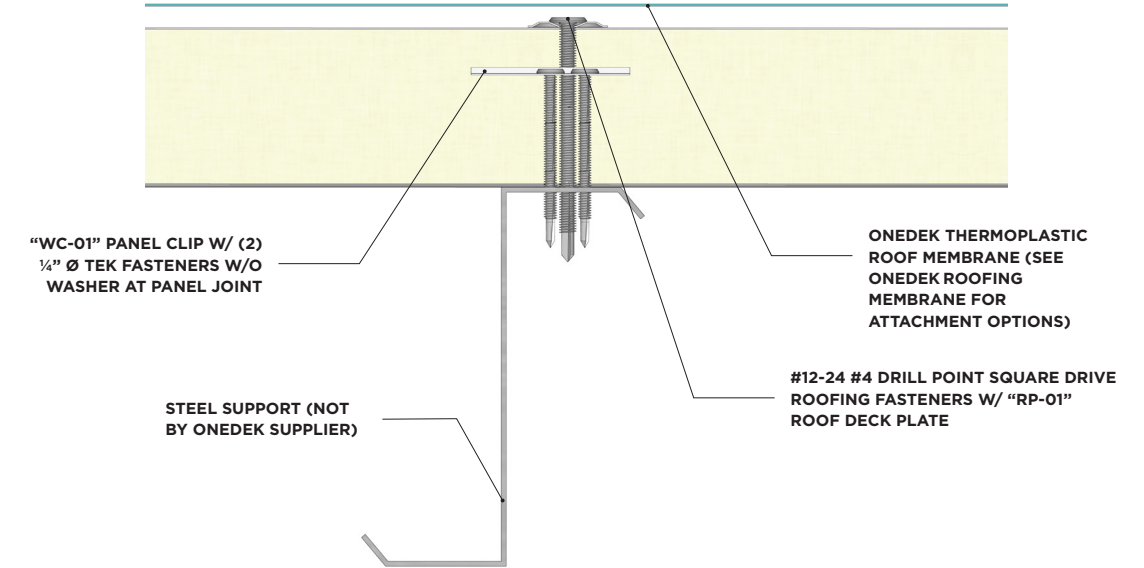


**FIGURE 10: INTERMEDIATE RD1/RD1-M ROOF FASTENING  
(SECTION VIEW)**




# Installation Instructions

**NOTE:** Fastening schedule may vary depending on specific application.

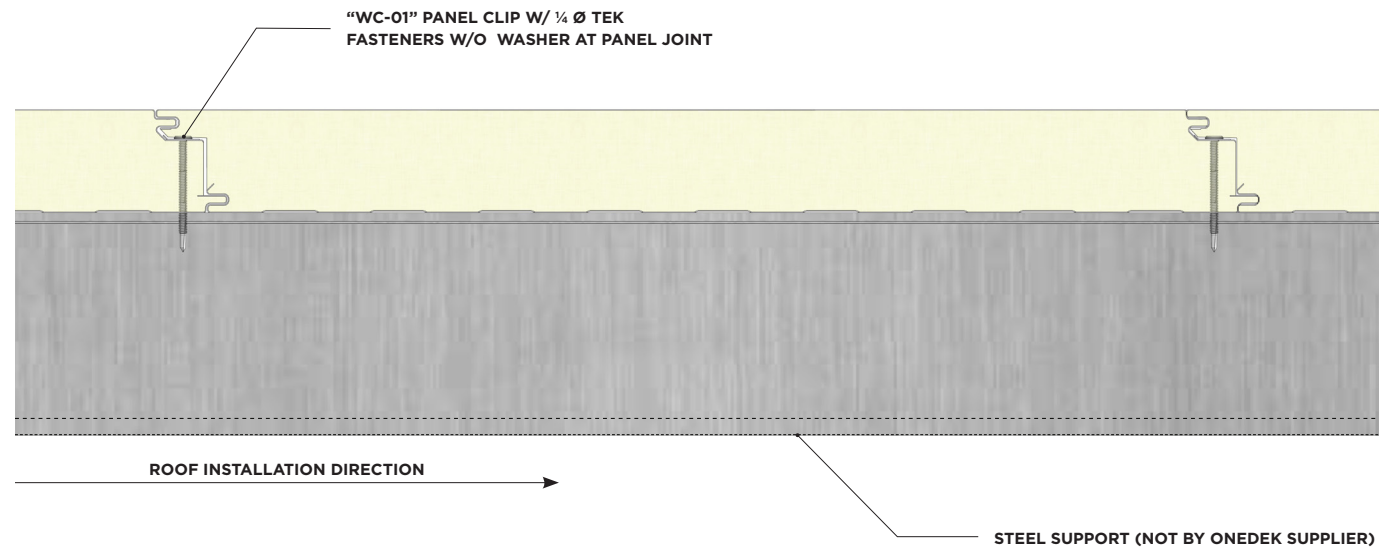

**FIGURE 11: RD1/RD1-M NON-DIAPHRAGM CLIP FASTENING SYSTEM (SECTION VIEW)**

**NOTE:** Fastening schedule may vary depending on specific application.

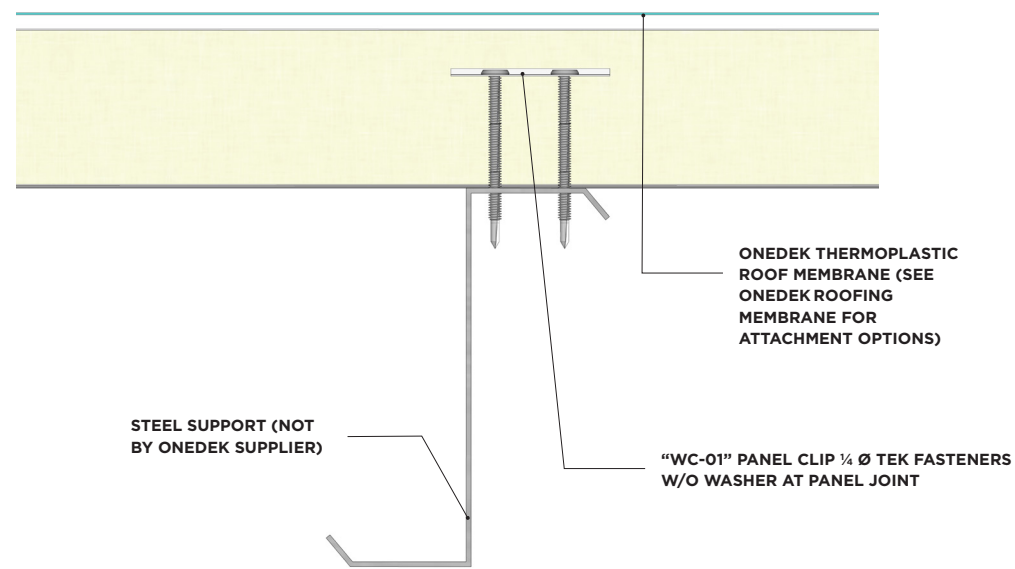

**FIGURE 12: INTERMEDIATE RD1/RD1-M ROOF FASTENING (SECTION VIEW)**

# Installation Instructions


## 3.9 ROOF PANEL END/BUTT JOINT FASTENING

When the roof system contains more than one course/row of panels the following steps should be observed for the fastening of the panel end/butt joint.

Place continuous beads of butyl sealant on the steel supports prior to setting the insulated roof deck panels as shown in *Figure 13* for Z- or C- Purlins or *Figure 14* for joists.

Following the installation sequence as outlined in "3.6 Installation procedure", the lower course panels should be installed first. Install the panel fasteners as described in the subsection mentioned above.


**NOTE:** Engineer of Record to determine the required attachment method of support angle to purlin and ensure continuity of shear load transfer at this location.

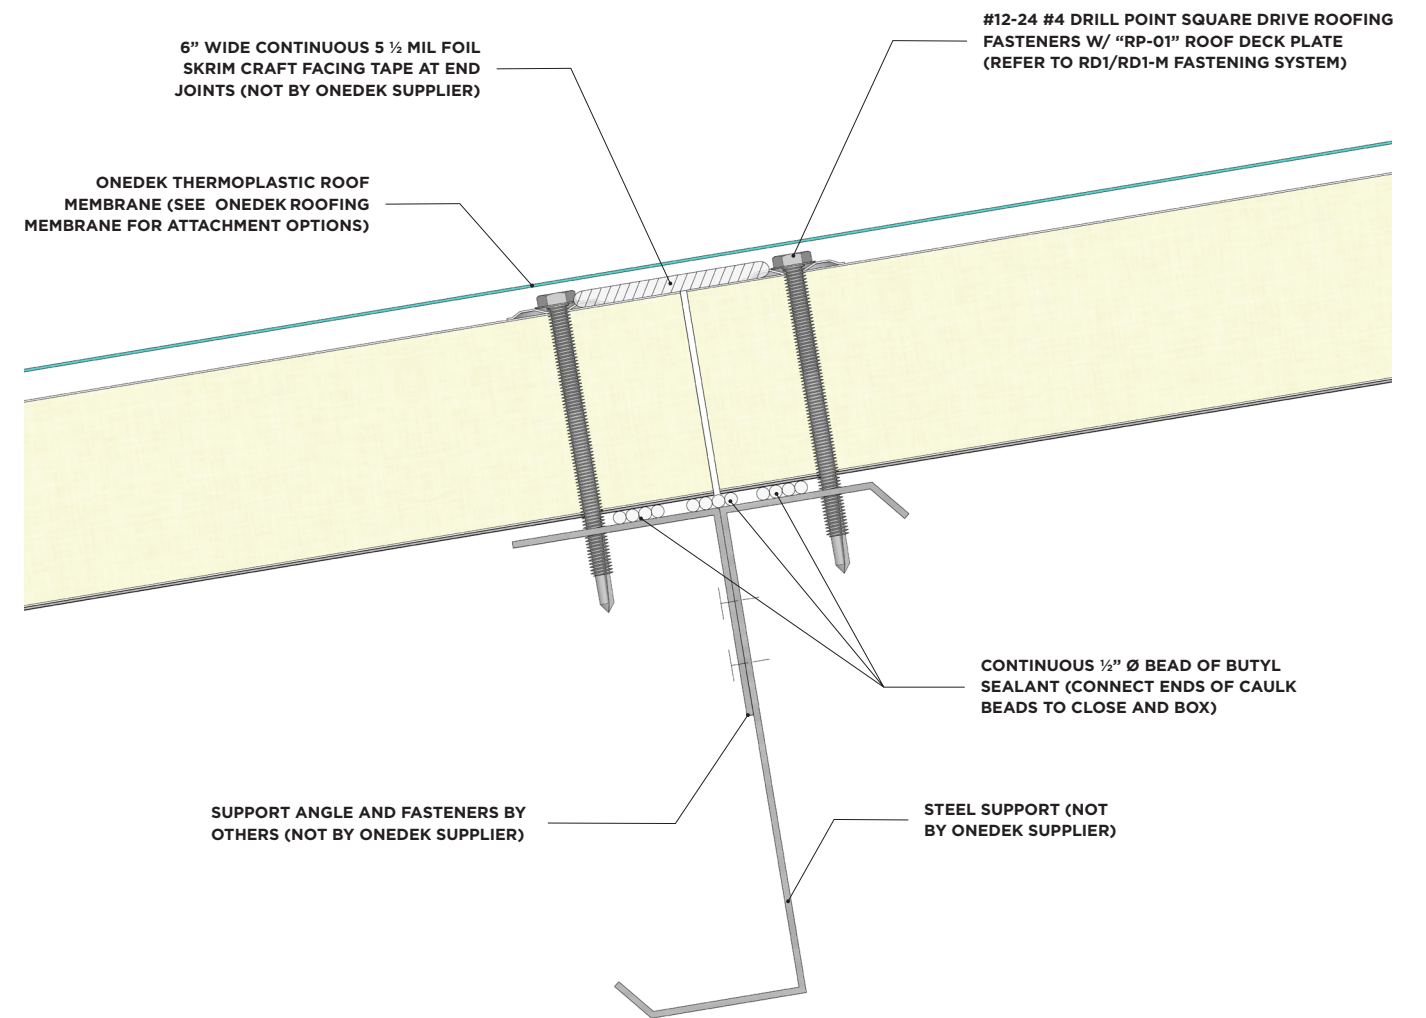

**FIGURE 13: BUTT JOINT DETAIL (SECTION VIEW)**

# Installation Instructions

**NOTE:** Fastening schedule may vary depending on specific application.

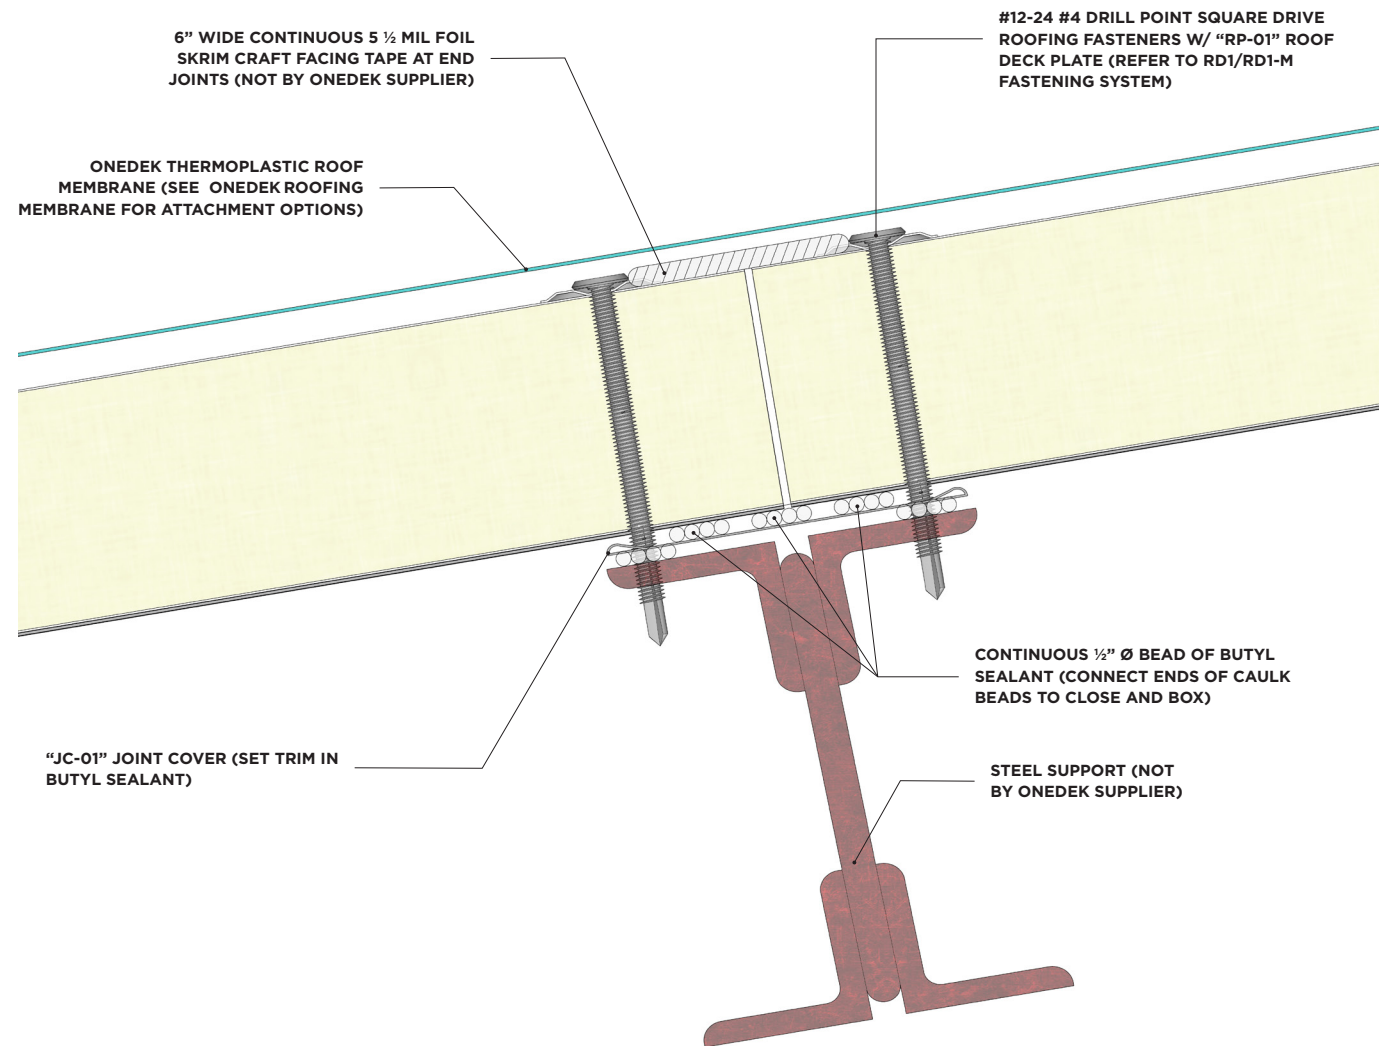

**FIGURE 14: JOIST DETAIL WITH JOINT COVER (SECTION VIEW)**


On gabled buildings, install the inside ridge cap after upper course panels on both sides of the ridge are installed.

Spray the ridge cavity continuously with two-part foamed-in-place urethane. Allow foam urethane to expand and cut off any excess protruding above the roof line.

Install outside ridge cap over the top of the insulated roof deck to cover cavity.

Remove all the metal chips and fillings from the drilling of pilot holes and fastening of the panels immediately after installation. These fillings will rust and corrode the panel surface and may damage the roofing membrane.

# Installation Instructions

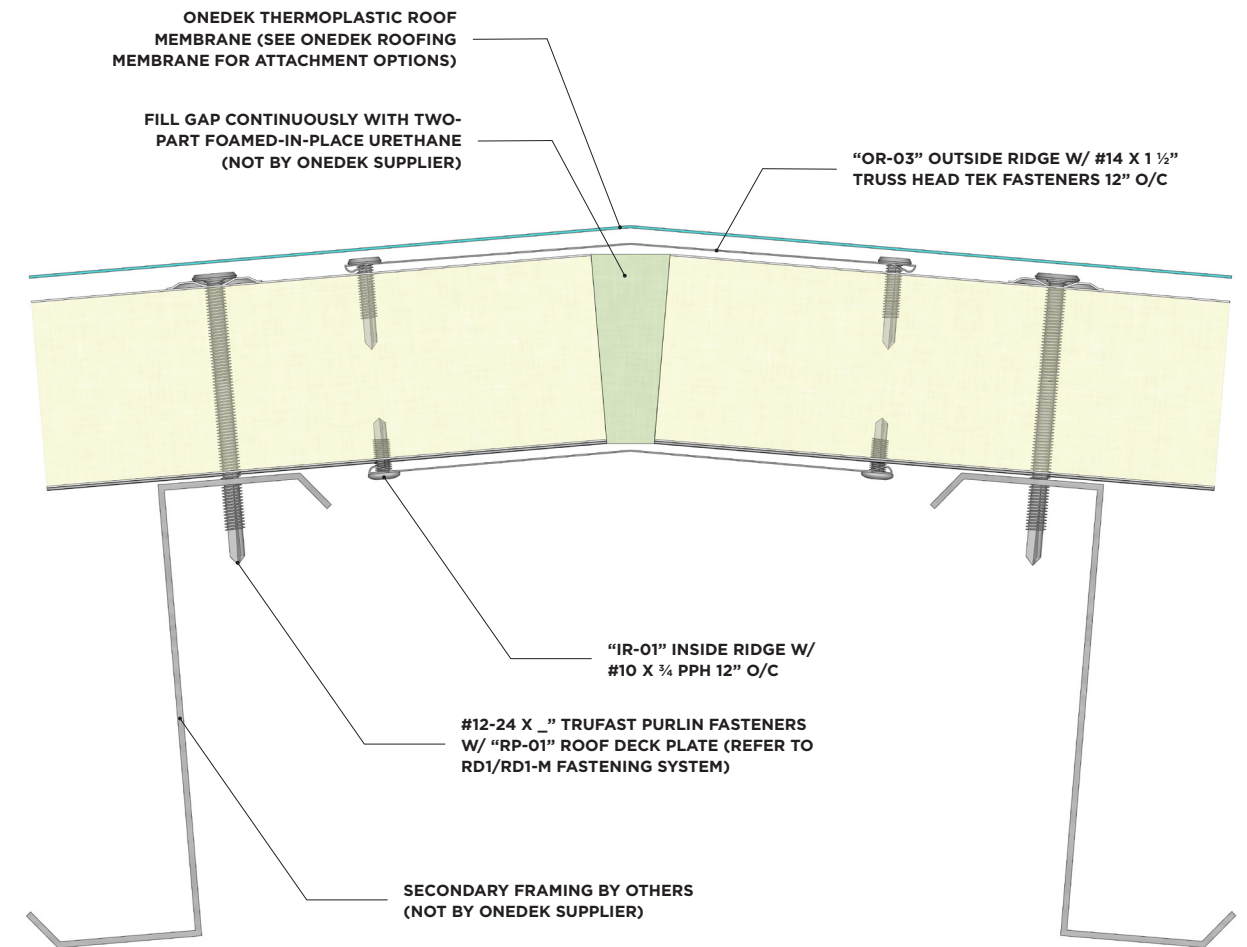

**FIGURE 15: RIDGE APEX (SECTION VIEW)**



# Miscellaneous Information

## 4.1 MISCELLANEOUS INFORMATION

To prevent galvanic action, isolate any aluminum trim surface(s) from surface of panel support steel using one of the following methods:

- A. an approved sealant or sealant tape;
- B. a non-absorbent gasket;
- C. duct tape or equivalent type tape;
- D. paint the incompatible metal with a coating of heavy bodied bituminous paint.

Flatness: oil canning or “scolloping” is an inherent condition of light gauge cold-formed metal products, particularly those with broad, flat areas, oil canning may be an aesthetic issue, particularly in conditions of angled light and does not affect the structural integrity or thermal performance of the panels. AWIP has adopted flatness tolerance parameters based on industry standards and provided by their coil steel suppliers, therefore, oil canning and perceived waviness that are within AWIP QC tolerances are not grounds for panel or trim rejection.

## 4.2 EXPOSURE TO HEAT OR FLAME

Although All Weather Insulated Panels urethane core panels are acceptable for use in non-combustible building assemblies in accordance with the International Building Code (IBC) and have been exhaustively tested for fire resistivity based on their end use, they are not non-combustible in and of themselves.

They are not “fire rated” per ASTM E119. Therefore, they shall not be exposed to extremely high temperatures or direct flame at any time. Simply stated, do not use a welding torch on or near insulated panels any more than you would on a wooden building assembly. Refer to panel test data information under “fire” for detailed information on ignition, heat of combustion, and surface burning.

# Panel Maintenance

## 5.1 CLEANING PANELS

After installation, surfaces must be cleaned to remove an metal chips to prevent any possible oxidation. A wet, soft cloth is recommended.

## 5.2 MEMBRANE MAINTENANCE

Proper installation and maintenance are extremely important to obtain the best performance and appearance from the insulated panels.

Dirt, oil, grease, fingerprints or any other kind of contaminant must be completely removed when the installation is finished to maximize coating(s) performance.

The building will require periodic maintenance according to site conditions (U.V. exposure, dirt, smoke, corrosive atmosphere, etc.). If further assistance is required, please consult All Weather Insulated Panels’ technical department.

To remove superficial oxidation and tough stains, it is recommended to use a regular household cleaner followed by a thorough rinsing. Wire brushes and/or abrasive material will damage the painted coating.

If “touch-up” paint is required, contact All Weather Insulated Panels to obtain a paint chip for color-matching.

Since metal-faced insulated panels are a modular system, they require joint and intersecting caulking to minimize potential leaks in the building envelope.

# OneDek Tapered Insulation Preparation

## 6.1 TAPERED INSULATION PREPARATION

All installation instructions for tapered insulation provided by All Weather Insulated Panels are to be used with OneDek tapered polyiso board systems and supplied adhesives only. Polyiso roof insulation boards used for your project must be provided by All Weather Insulated Panels for proper certification and performance. Tapered polyiso board systems are optional features and may not be included in all roof installation. Please refer to project specific details to determine what is needed for your project.

Tapered polyiso boards may be used on a wide range of roof systems to ensure proper slope and drainage around features such as parapets, roof curbs, and other roof accessories. They can be used on both mechanically fastened systems or fully adhered systems.

If tapered insulation is included on the project, it must be installed prior to installation of membrane.

Ensure the area is clean, dry, and free of foreign materials that will damage insulation or impede installation. Inspect to confirm that insulation boards are clean and free of damage. Replace any boards that are irreparably damaged or cannot be cleaned. If adhesive is required, fasteners must seat properly and plates flush on the membrane leaving an acceptable surface to receive the adhesive.

Verify that any accessories, such as roof drains, scuppers, roof curbs, nailers, equipment supports, vents, and other roof accessories are secured properly and installed in conformance with Contract Document. Refer to section 10 for more information on scuppers and internal drains.

## 6.2 TAPERED INSULATION INSTALLATION



Cut polyiso boards in accordance with project specific detailing. Install with end joints staggered to avoid having insulation joints coinciding with joints in deck. In multi-layer installations, stagger joints in top and bottom layers.

## 6.3 MECHANICALLY ATTACHED TAPERED INSULATION SYSTEMS

Install boards in place along edges of parapet, curbs, or other roof structures in accordance with layouts provided for your project. Use #15-13 truss head fasteners with RP-01 roof plates to secure boards in place.

**Note:** Place appropriate length fasteners across the entire layout of boards such that all fasteners penetrate the top facing, but do not extend to the interior steel face of the OneDek roof panels. The appropriate length may vary.

# OneDek Tapered Insulation Preparation

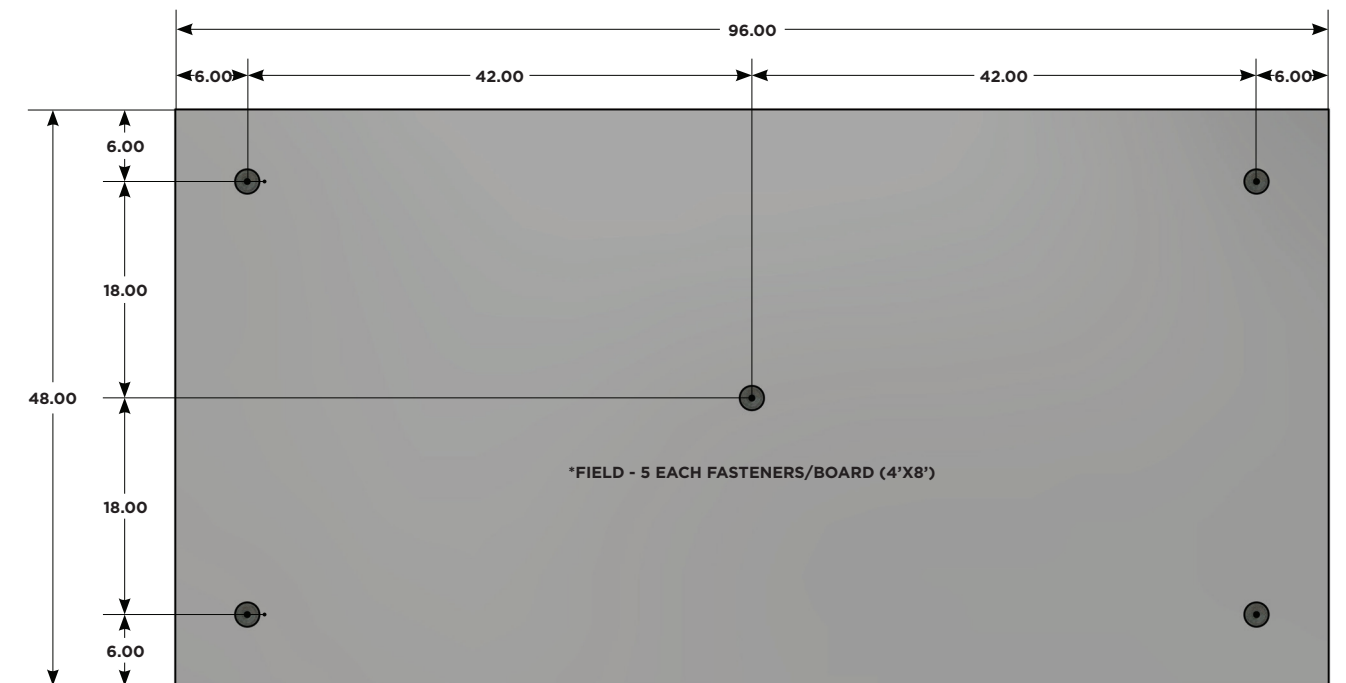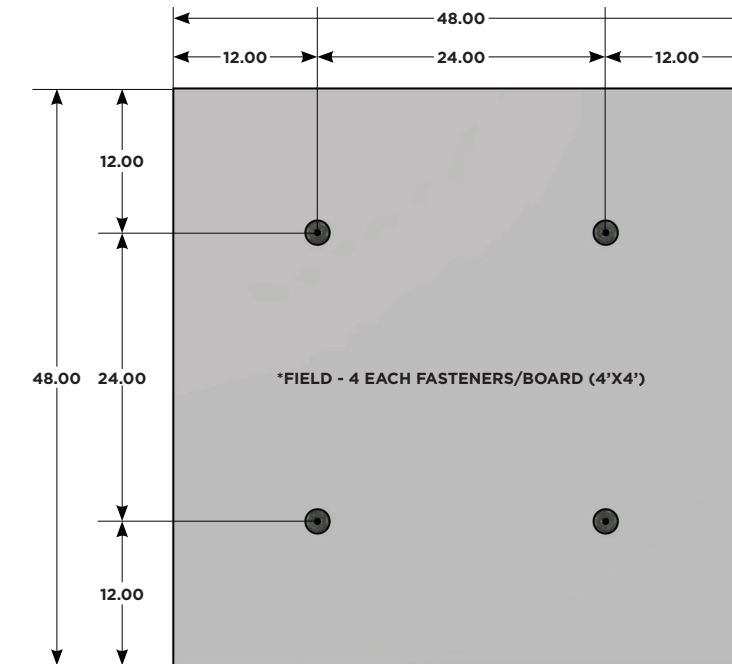

# OneDek Tapered Insulation Preparation


## 6.4 FULLY ADHERED TAPERED INSULATION SYSTEMS

Fully adhered tapered roof insulation systems require special adhesives to bond the insulation boards to the primer surface of the insulated roof deck panels. It is important that the appropriate bonding adhesive is selected for tapered insulation.

Use the correct supplied adhesive for adhering tapered insulation to the roof deck. Refer to project documents for information. Only apply this adhesive to roof area where tapered insulation will be installed. Verify the maximum insulation board size for your adhesive. If boards exceed size requirements, divide in half before installation. Do not use warped boards.

### Apply adhesive using the following procedures:

1. Only apply adhesive when ambient temperature is at least 40 °F.
2. Follow manufacturer instructions to properly load & prepare dispensing equipment. Purge the lines of air and ensure adhesive is free flowing and mixed properly before application begins.

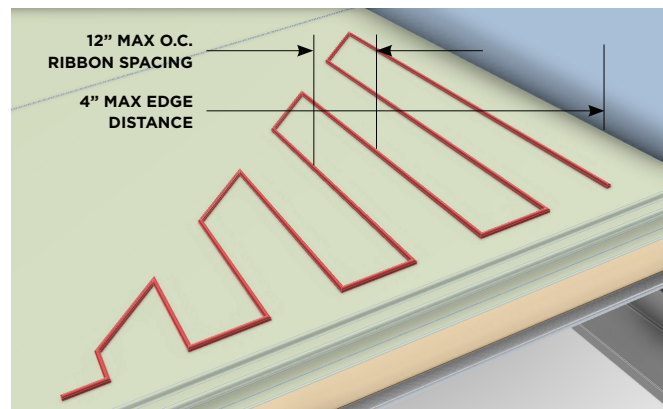

## 6.5 TAPERED INSULATION PROTECTION

Clean the area after installation and remove all construction debris before membrane installation. Protect the area from roof traffic with protective covering materials throughout the roof installation.

3. Apply adhesive to the roof deck in continuous, approximate ¾" wide beads spaced 12" on center or as specified for your project. Space adhesive ribbons no more than 4" from all perimeter edges. The adhesive will spread and rise several inches. Replace mixing tips if stopping application for more than 30 seconds. Do not allow the adhesive time to dry to a "tack-free" condition before boards are applied.
4. Once adhesive has risen, begin placing boards. Carefully place the boards into alignment and step or walk on boards to ensure firm contact with adhesive. Weights may be placed temporarily atop the boards to secure while working.
5. Work continuously across your board layout to complete the layer. If boards experience slipping or movement while placing, delay placing additional layers of insulation board atop until the slippage reaches a minimum.
6. Repeat the procedure to set in place additional layers of insulation. Once all boards have been placed and are free of slippage, the area is prepared for membrane.

Do not leave tapered insulation system exposed to weather. The system should be covered and waterproofed immediately after installation. Seal exposed edges temporarily at the end of each day. Inspect and replace insulation that incurs weather damage.

# OneDek Membrane Preparation

## 7.1 MEMBRANE PREPARATION

All membrane installation instructions provided by All Weather Insulated Panels are to be used with OneDek TPO, PVC or Fleeceback membranes only. If the membrane used for your project is not provided by All Weather Insulated Panels, please contact your membrane manufacturer for installation instructions.

OneDek membranes are manufactured to meet wide range of roof construction requirements. They can either be used on mechanically fastened systems or fully adhered systems.

Ensure area is clean and dry prior to welding process. Use low sudsing soap and water followed by a membrane cleaner to remove dirt, contaminations, grease, oil, etc. Cut affected section of the membrane sheet and replace with a new section if no other options are left and membrane cannot be properly cleaned.

## 7.2 MEMBRANE WELDS AND SEAMS

Typical hot-air welding of membranes is done by applying hot air on the surfaces, softening them and fusing them together — creating a permanently fused, bonded sheet.

**NOTE:** Welding speeds will be slower in high humidity conditions or at low temperatures.

Seams must be loaded in shear, not in peel. A shear load is applied in the horizontal plane of the OneDek membrane. A peel load is applied by lifting the seams perpendicular to the roof. Membrane can experience mechanical stresses due to expansion and contraction of the roof. It is important to avoid welding that causes the seams to peel.

To avoid problems in cold weather with temperature below 50°F using hot air welding, follow listed suggestions below:

1. Store OneDek membranes away from sparks/flare sources to keep good weld quality.
2. Condensation can also affect the weld quality on OneDek membranes. To avoid this, store all membranes in warm, dry areas.
3. Use scrap material to test peel resistance to ensure there are no inferior welds. Take at least twice the usual number of seam samples.
4. Dry all membrane weld areas prior to welding process.
5. Membranes may be extremely slippery on dew, frost, ice or snow-covered roofs. Exercise caution.

Automatic hot-air welders provide fast and efficient methods to weld membrane seams. They are required on all areas the automatic welder can access. Follow the steps below and always consult the hot air welder manufacturer for specific instructions and recommendations for your project

1. Use the variable speed control to adjust the machine's travel speed along the seam.
2. Movement of the welder along the seam is determined by heat setting based on air temperature.
3. To start welding, insert the nozzle 2" into the weld area. Dial in desired temperature and speed.
4. Raise the back wheel of the machine to allow it to ride on its wheels.



# OneDek Membrane Preparation

## 7.2 MEMBRANE WELDS AND SEAMS (CONTINUED)

Hand-held hot-air welding can be used on difficult to reach membrane sections such as corners, penetrations, and vertical surfaces.

With either the machine or the hand-held hot air welding, perform 4' or 5' test welds at the beginning of each day or every time the weld tool is turned off. This is to ensure the peel strength, consistency, weld width and allows for welder adjustment. Weld testing procedures are listed below:

1. Adjust the temperature of the weld tool to produce a shiny membrane surface without burning the membrane.
2. Insert the nozzle tip of the hot air weld into the seam and moving it slowly backwards.
3. Press the membrane surfaces together with a silicone rubber roller as the membrane softens from the inside edge to the outside edge of the seam.
4. Ensure no air is captured during the welding process.

A good weld cannot be achieved with a burned membrane surface. The burned or discolored membrane must be patched. To repair a burned section, follow the listed procedures below:

1. Cut away the damaged material at least 1" beyond the burned edges.
2. Cut patches so it extends at least 3" beyond all damaged edges to allow for a minimum 1 ½" weld width at all sides.

## 7.3 MEMBRANE ADHESIVES

Fully adhered membrane systems require special adhesives to bond the membranes to the primer surface of the insulated roof deck panels. It is important the appropriate bonding adhesive is selected for the type of membrane to be installed.

For PVC smooth back membranes, use LA432M solvent-based bonding adhesive.

3. Place the patch at the center of the cut area. apply a 1 ½" weld to fuse the patch to the membrane.
4. For a neat and finished roof appearance, cut all patches in square or rectangular shapes with round corners.

Apply t-joints where three or more layers of membranes intersect. Voids may occur on these locations. To install t-joints, follow procedures below:

1. Ensure that the splice intersection and the t-joint cover is clean and dry.
2. Center t-joint cover over splice intersection.
3. Begin welding from the center point of the t-joint and work towards the outside.
4. Check all welds once completely cooled with a seam probe (*see below specific instructions*).

After welding and once the seams cool down, test if there are any voids in the weld by probing seams following the procedures listed below:

1. Along the seam edges, run a blunted scratch awl, cotter key puller or other round-tipped, blunted tool while applying firm and steady pressure.
2. Blunt the tip of the tool regularly to keep the tool from sharpening. Continuous probing tends to sharpen the probe tool.
3. Any penetration of the probe into the seam indicates a void in the weld.

For TPO smooth back membranes, use LA505 solvent-based bonding adhesive.

For PVC/TPO fleeceback membranes, use LA505 solvent-based bonding adhesive.

# OneDek Membrane Preparation

## 7.4 MEMBRANE FLASHING

Do not use temporary flashings. Install the membrane and membrane flashings simultaneously. When water penetration occurs, be sure to immediately replace all affected materials.

Extend all flashings a minimum of 8" above the roof level. Terminate all flashings per applicable details.

## 7.5 MEMBRANE INSTALLATION

Without stretching the membrane, roll out the OneDek membrane over the panels and let it relax prior to installation. It must relax for 15 minutes when the temperature is above 60°F or 30 minutes when the temperature is below 60°F. Longer times may be necessary on very cold weather condition. Inspect for any damaged membranes. remove damaged or creased sections of the membrane.

The membrane sheets must be installed perpendicular to the roof slope starting at the eave and working up to the peak. The next membrane must overlap the previous membrane at the sidelap by 6".

OneDek membranes must be properly secured onto the insulated roof deck to prevent wind uplift. Project specific membrane plates and fasteners are used for mechanically fastened systems and LA505 or LA432M bonding adhesives are used for fully adhered systems.

Refer to project specifications and shop drawings when determining fastener systems and configurations.

On mechanically fastened systems, refer to project specifications, shop drawings and ASCE roof diagrams for the determination of infield, perimeter and corner zones.

# Mechanically Attached Systems

## 8.1 INFIELD ZONE INSTALLATION

Install wide full width membrane sheets at the edge with #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center along the upper edge of the membrane. The fasteners only penetrate the top facing of the OneDek panels.

## 8.2 PERIMETER ZONE INSTALLATION

**Option:** Half Sheet Installation

1. Install half width membrane sheets at the edge with #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center along the upper long edge of the membrane.

**Option:** Full Sheet Installation

1. Install full width membrane sheets at the edge with #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center along the upper long edge of the membrane.
2. Install #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center in rows halfway and equidistant between center points of membrane sidelaps.
3. Heat weld 8" wide cover strips to cover exposed fasteners. Ensure minimum 1 ½" weld on each side of fastener.

# Mechanically Attached Systems

## 8.3 CORNER ZONE INSTALLATION

**Option:** Half Sheet Installation

1. Install half width membrane sheets at the edge with #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center along the upper long edge of the membrane. (*Step 1 of Perimeter Half Sheet Installation*).
2. Install additional row of #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center in rows halfway and equidistant between center points of membrane sidelaps.
3. Heat weld 8" wide cover strips to cover exposed fasteners. Ensure minimum 1 ½" weld on each side of fastener.

**Option:** Full Sheet Installation


1. Install full width membrane sheets at the edge with #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center along the upper long edge of the membrane. (*Step 1 of Perimeter Full Sheet Installation*).
2. Install two rows of #15-13 x 1 ¼" truss head fasteners with RP-02 barbed membrane plates at 6" on center in rows one-third and two-thirds distant between center points of membrane sidelaps.
3. Heat weld 8" wide cover strips to cover exposed fasteners. Ensure minimum 1 ½" weld on each side of fastener.

On membrane endlaps and sidelaps, maintain at least ½" distance from the edge of the RP-02 plates to the edge of the membrane. Fastener spacing is per job specifications.

Without overdriving the fasteners, tightly screw them down with the plates using an appropriate screw gun with adjustable torque clutch. Fasteners must be installed perpendicular to the OneDek panel surface. They must also fully penetrate the exterior facing of the panel.


Weld endlap and sidelap seams.

# Mechanically Attached Systems

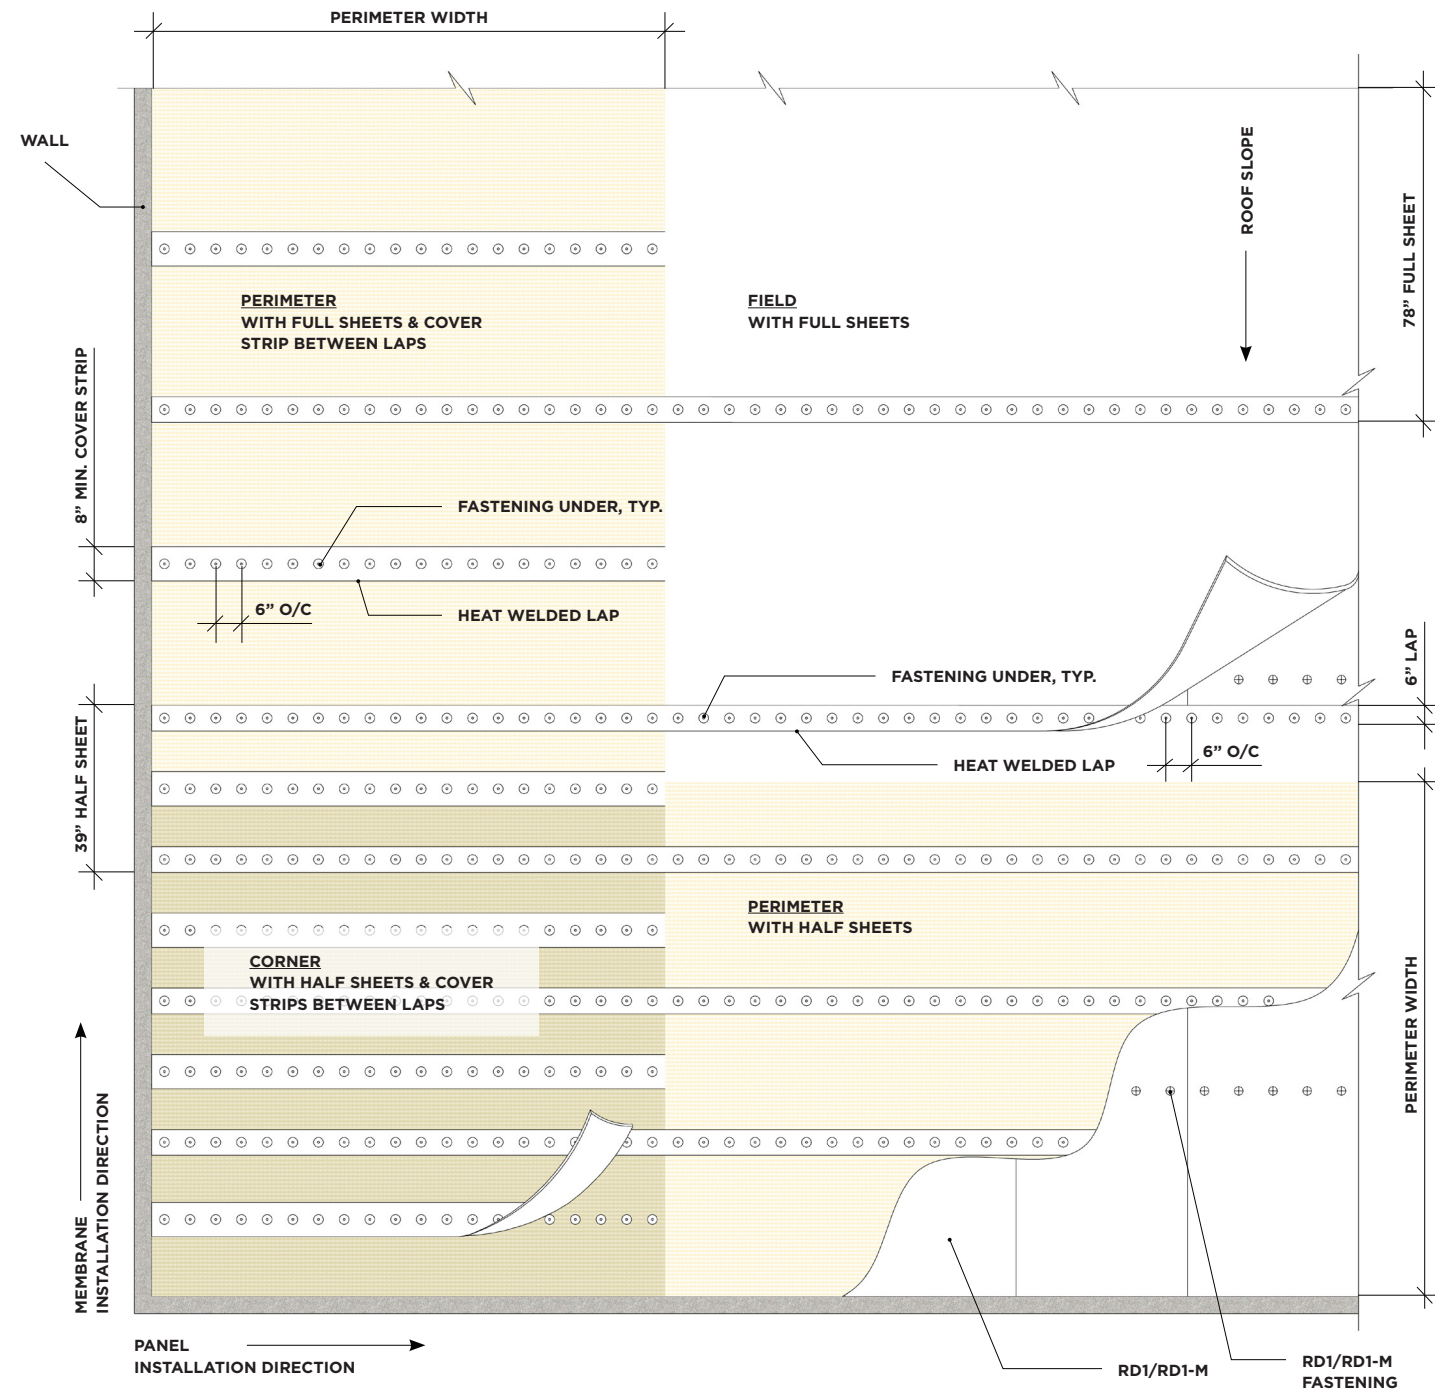

**FIGURE 16: ONEDEK MECHANICALLY ATTACHED TPO/PVC MEMBRANE (USING PERIMETER HALF SHEETS) (PLAN VIEW)**

# Mechanically Attached Systems

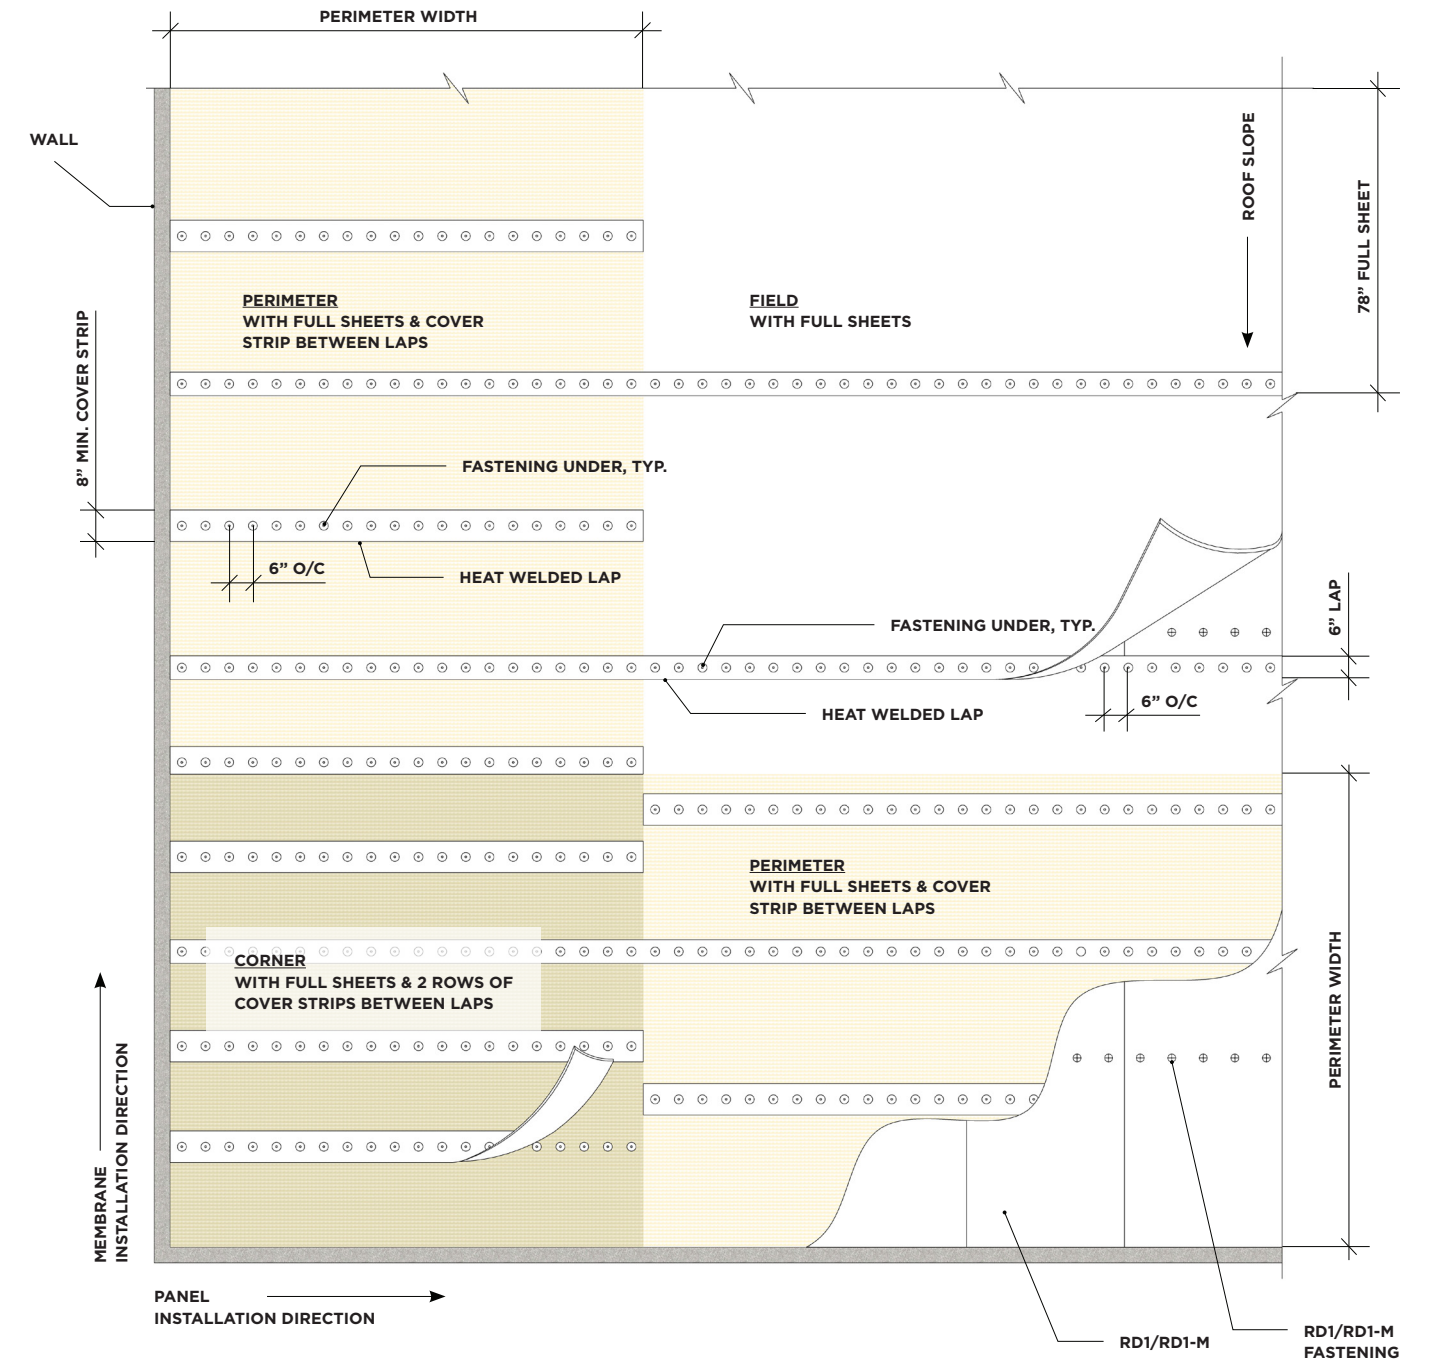

**FIGURE 17: ONEDEK MECHANICALLY ATTACHED TPO/PVC MEMBRANE (USING COVER STRIPS) (PLAN VIEW)**



# Fully Adhered Systems

OneDek membranes to be applied with adhesives must be approved by AWIP and adhered to a primer surface. Both surfaces must be clean, dry, compatible and free of contaminants and grease/oil.

If required, fasteners must seat properly and plates flush on the membrane leaving an acceptable surface to receive adhesive.

Position membranes with 2" overlap between sheets. Fold membrane in half along its length exposing its bottom side.

Make sure adhesive container is sealed. To make sure adhesive is uniform in color and all solids are dispersed with no swirls, turn container upside down and wait for a minimum of 5 minutes. Turn container right side up and carefully open it and stir vigorously.

Dip roller into can to saturate it. For smooth-backed membranes, roll adhesive onto substrate and membrane. For fleeceback membranes, roll adhesive onto substrate only.

## Apply adhesive using the following procedures:

1. Only apply adhesive when ambient temperature is at least 40 °F.
2. The presence of the spider web effect can occur with stringers off the roller when the roller needs to be redipped into the adhesive. It will also be hard to push the roller.

## 9.1 ADHESIVE APPLICATION RATE

### OneDek PVC Membrane - LA432M

Apply adhesive to the membrane and substrate which are clean, dry and free of debris. Apply at the rate of approximately 120 square feet per gallon per surface, sufficient to bond 60 square feet of membrane in place.

3. Using a 3/8" nap solvent resistant roller, apply adhesive in a smooth, even, thin coat to both membrane and substrate at the rates listed below.
4. Seam areas must remain clean and dry. No adhesive must be applied on the seams.
5. Avoid over-coating adhesives. More is not necessarily better.
6. Allow adhesive to partially dry (approximately 5 - 10 minutes) to a tacky feel when touched.
7. When the adhesive is applied and ready, roll the membrane into the substrate carefully to avoid wrinkles or air entrapment. Use lawn or linoleum heavy roller to ensure good contact between substrate and membrane. Make sure to apply even pressure when using a lawn or linoleum heavy roller.
8. Do not allow adhesive to dry completely. If no longer tacky, it cannot be used. TPO/PVC systems require adhesive to become tacky to touch on both surfaces without stringers.
9. Coverage, open time and dry time rate can vary depending on particular substrate and environmental conditions.

### OneDek TPO Membrane - LA505

Apply adhesive to the membrane and substrate which are clean, dry and free of debris. Apply at the rate of approximately 200 - 240 square feet per gallon per surface, sufficient to bond 100 - 120 square feet of membrane in place.


### OneDek TPO and PVC Fleece-backed Membrane - LA505

Apply adhesive to the SUBSTRATE ONLY at the rate of approximately 100-120 square feet per gallon.


# Penetrations and Membrane Repair

To protect the OneDek membrane, use additional layer of OneDek membrane or a layer of polyester material under paver blocks if pavers are needed to be used as permanent walkways for rooftop equipment maintenance.

## 10.1 OUTSIDE CORNER INSTALLATION

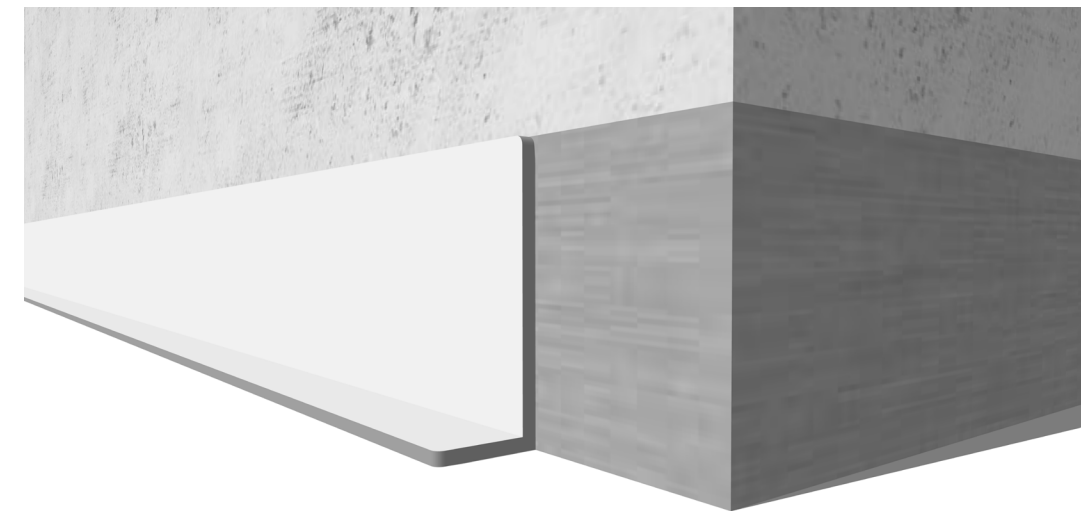


Cut the membrane flashing and extend minimum of 8" vertically. Alternatively, an 18" curb flashing can be used. Make sure it leaves enough section at the base flashing with the membrane overlapping the fasteners and leaving a 1 1/2" minimum weld area.

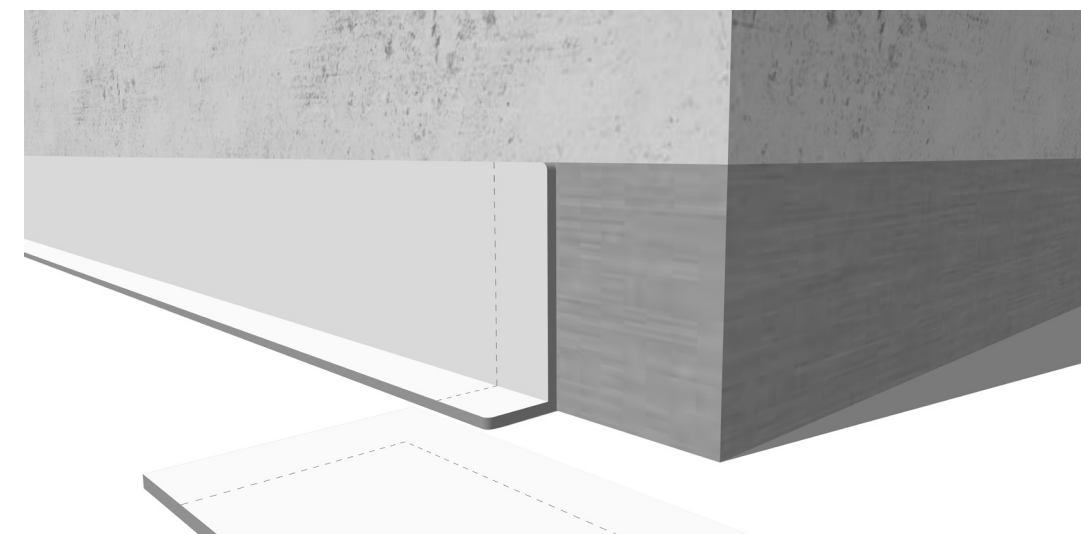


Install the next membrane flashing with 2" lap over the previously installed sheet.

# Penetrations and Membrane Repair

## 10.1 OUTSIDE CORNER INSTALLATION (CONTINUED)

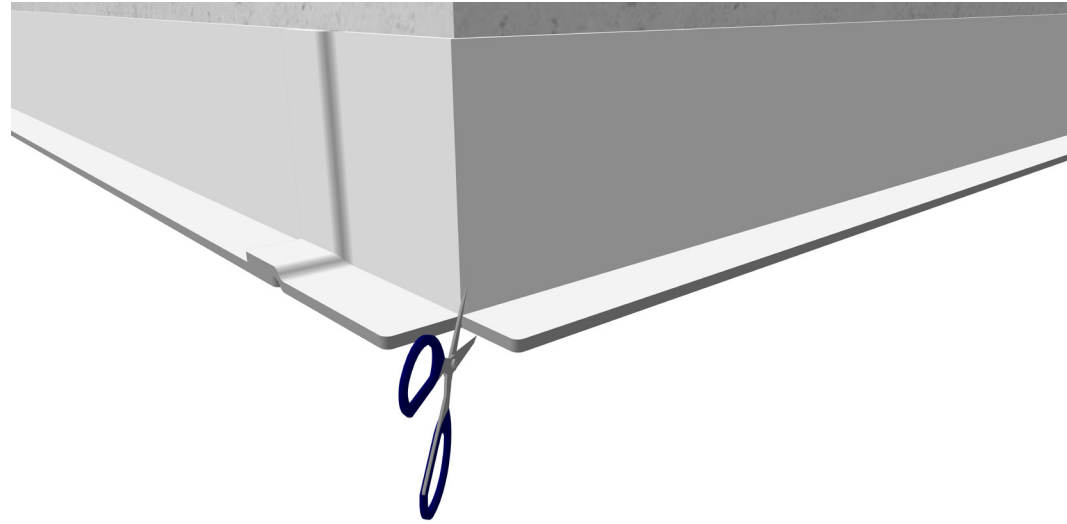


Form membrane to wall as required. Membrane flashings must extend 12" horizontally at each direction from the curb corner point. Cut membrane base to allow flashing to turn at corners. install fasteners or apply adhesives as necessary.

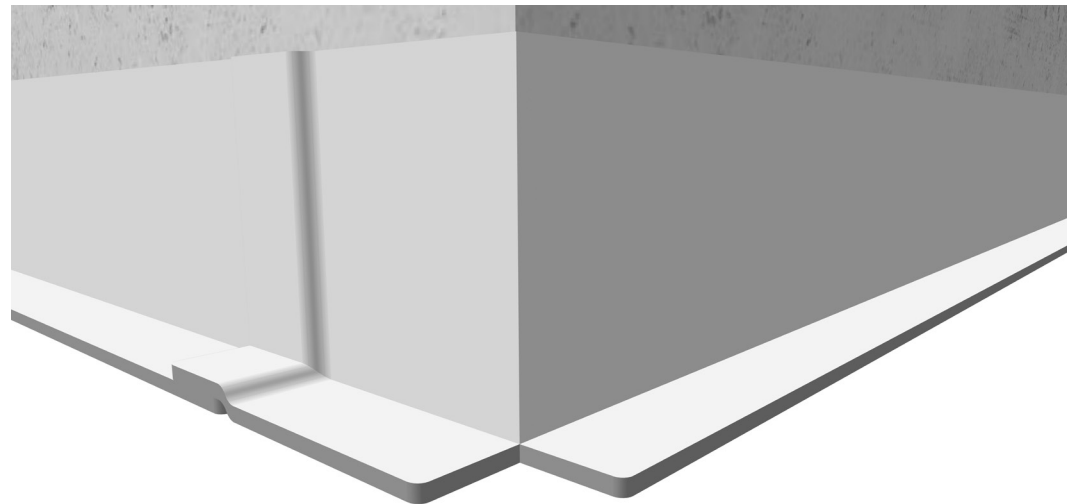

Round the corners of the membrane base overlap (on each side of the corners) and the flashing base overlap (at all ends).


# Penetrations and Membrane Repair

## 10.1 OUTSIDE CORNER INSTALLATION (CONTINUED)

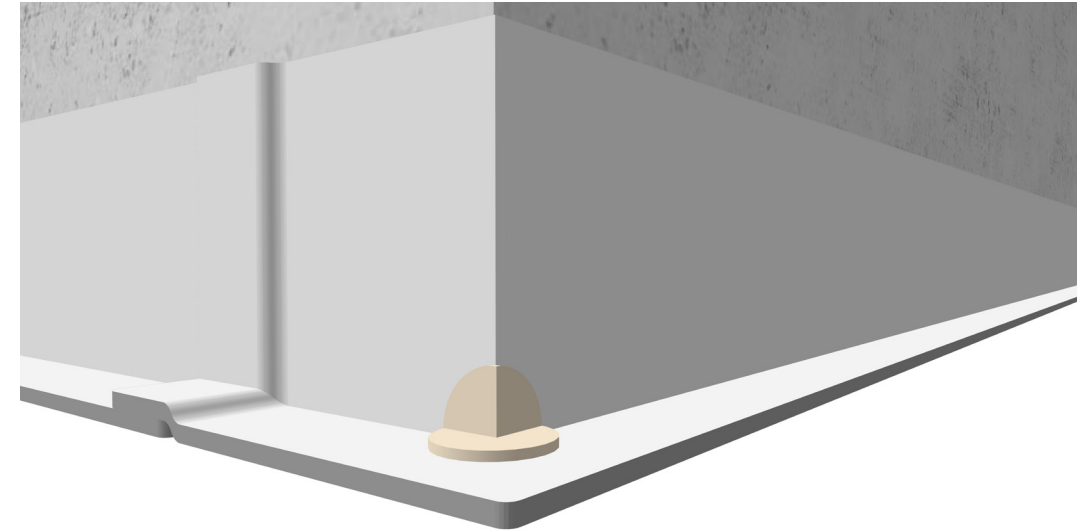

Weld a universal corner to the membrane flashings with a continuous 1" heat weld. Leave an unwelded area at the center of the corner to allow for movement. Probe all welded seams.


## 10.2 INSIDE CORNER INSTALLATION

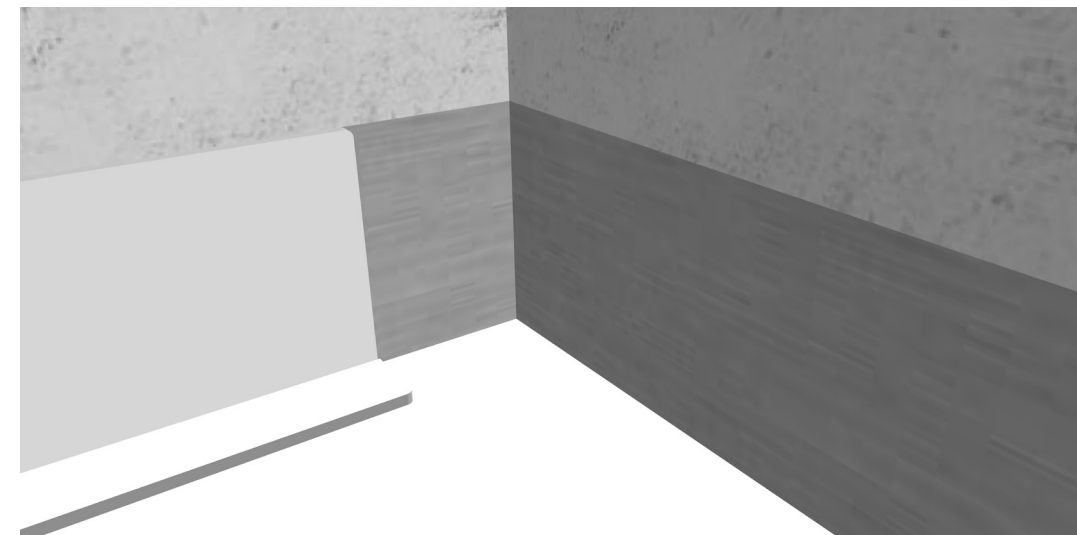


Cut the membrane flashing and extend minimum of 8" vertically. alternatively, an 18" curb flashing can be used. Make sure it leaves enough section at the base flashing with the membrane overlapping the fasteners and leaving a 1 1/2" minimum weld area.

# Penetrations and Membrane Repair

## 10.2 INSIDE CORNER INSTALLATION (CONTINUED)

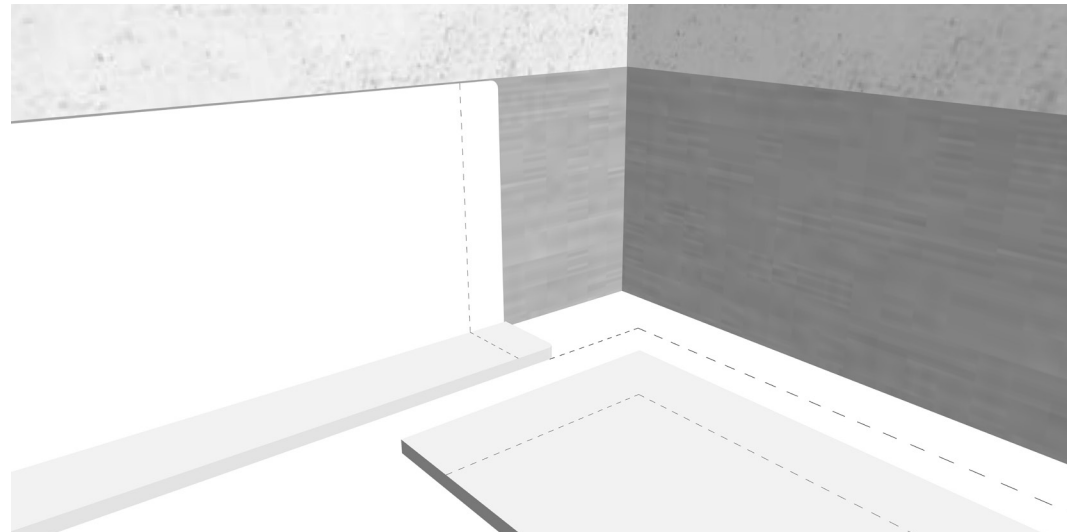


Install the next membrane flashing with 2" lap over the previously installed sheet.

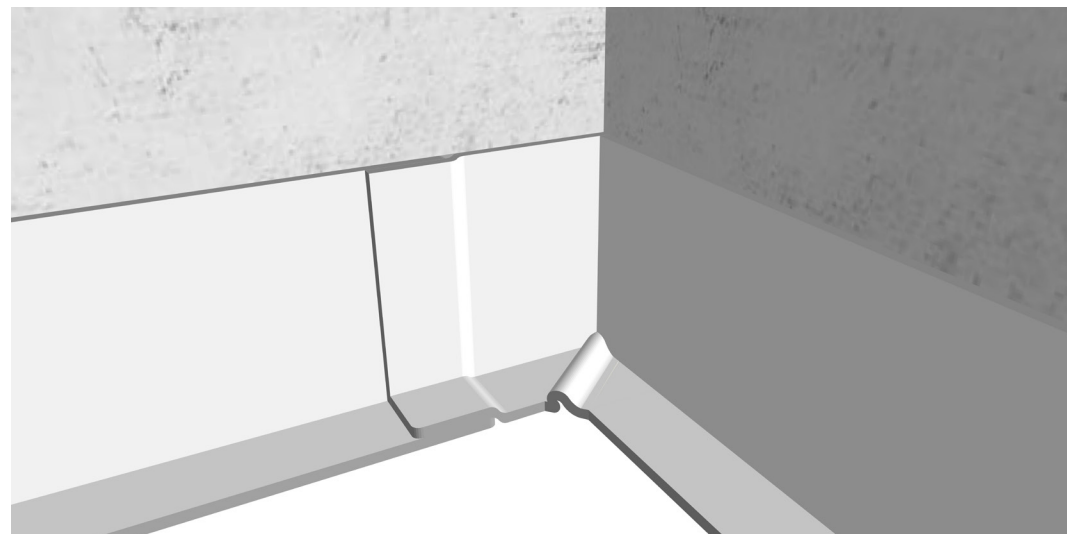


Form membrane to wall as required. membrane flashings must extend 12" horizontally at each direction from the curb corner point. Fold over the membrane flashing base lap (forming a "pig's ear") to allow the membrane flashing to turn the corner.

# Penetrations and Membrane Repair

## 10.2 INSIDE CORNER INSTALLATION (CONTINUED)

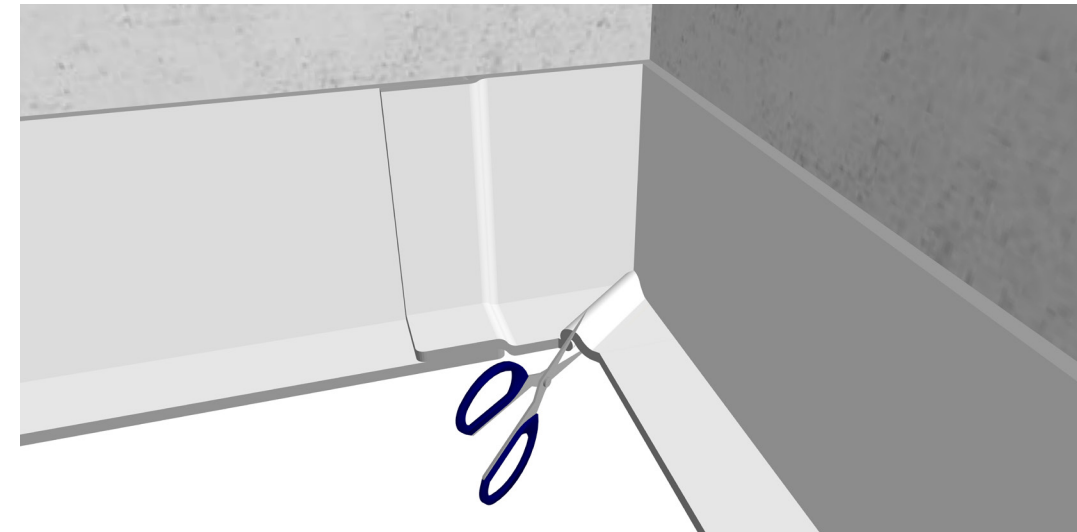

To form an overlap, make a diagonal cut at the "pig's ear". Round the corners of the membrane base overlap (on each side of the corners) and the flashing base overlap (at all ends).

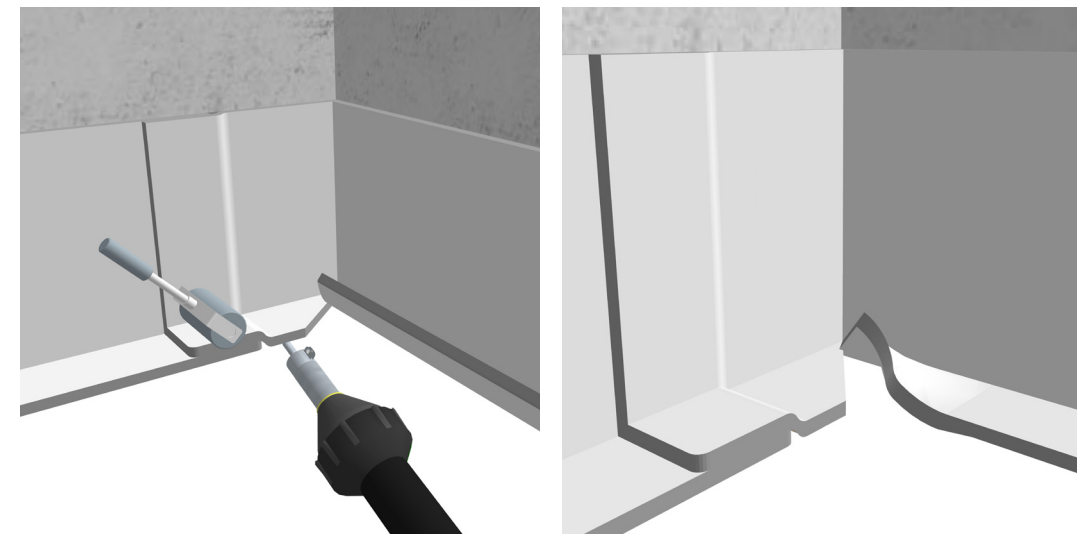


Using a hand-held welder and roller, weld the bottom flap to the membrane and the top flap over the bottom flap.



# Penetrations and Membrane Repair


## 10.2 INSIDE CORNER INSTALLATION (CONTINUED)

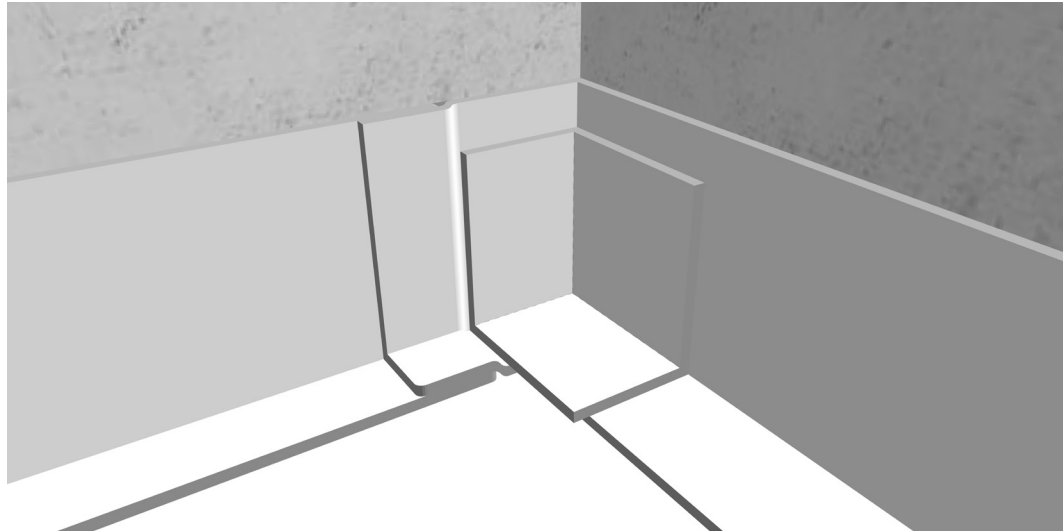

Weld a universal corner to the membrane flashings with a continuous 1" heat weld. Leave an unwelded area at the center of the corner to allow for movement. Probe all welded seams.


# Penetrations and Membrane Repair

## 10.3 MEMBRANE CURB FLASHING (CONTINUED)

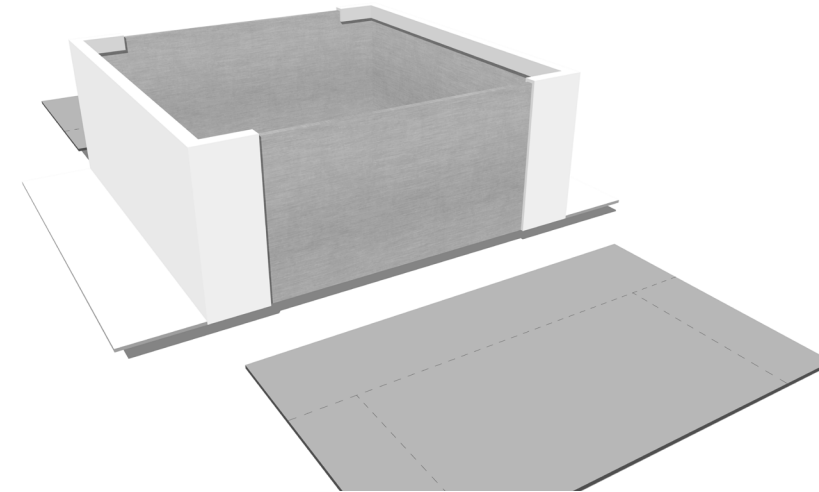


Install the next membrane flashing with 2" lap over the previously installed sheet. The membrane flashing should overlap 2" minimum from the corner as shown.

## 10.3 MEMBRANE CURB FLASHING

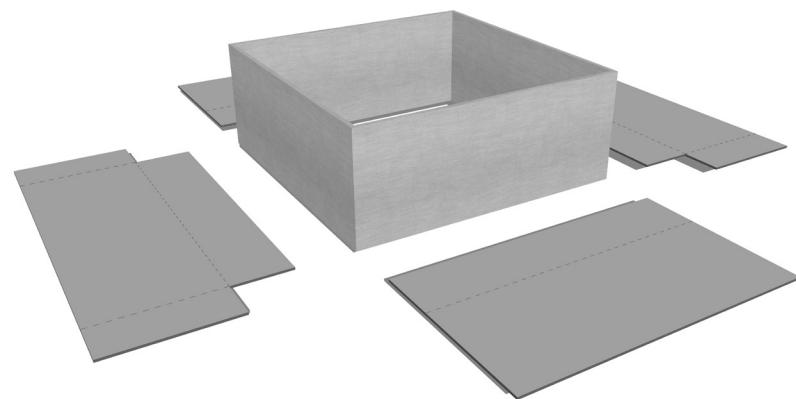


Cut the membrane flashing and extend minimum of 8" vertically. Alternatively, an 18" curb flashing can be used. Make sure it leaves enough section at the base flashing with the membrane overlapping the fasteners and leaving an 1 1/2" minimum weld area.

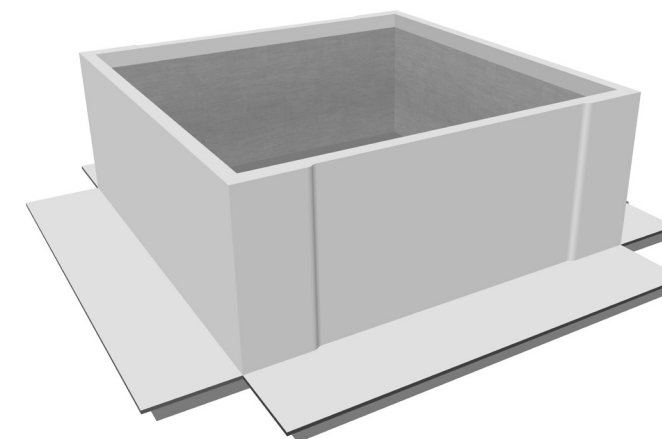

Form membrane to curb as required.


# Penetrations and Membrane Repair

## 10.3 MEMBRANE CURB FLASHING (CONTINUED)

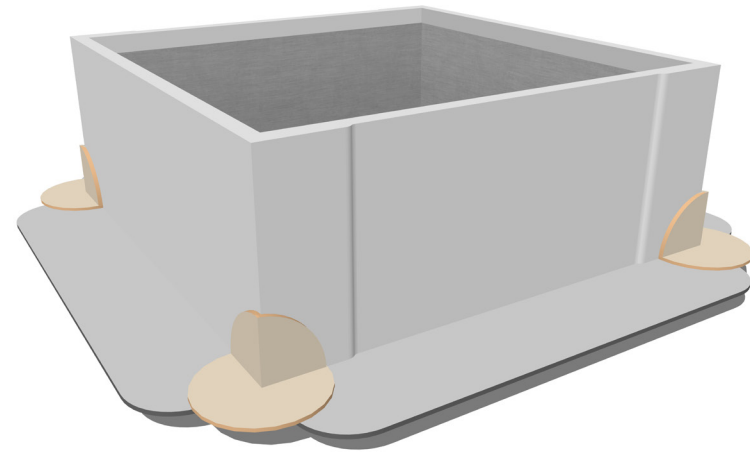

Round the corners of the membrane base overlap (on each side of the corners) and the flashing base overlap (at all ends). At each corner, weld a universal corner to the membrane flashings with a continuous 1" heat weld. Leave an unwelded area at the center of the corner to allow for movement. Probe all welded seams.


## 10.4 CANTED BASE CURB FLASHING

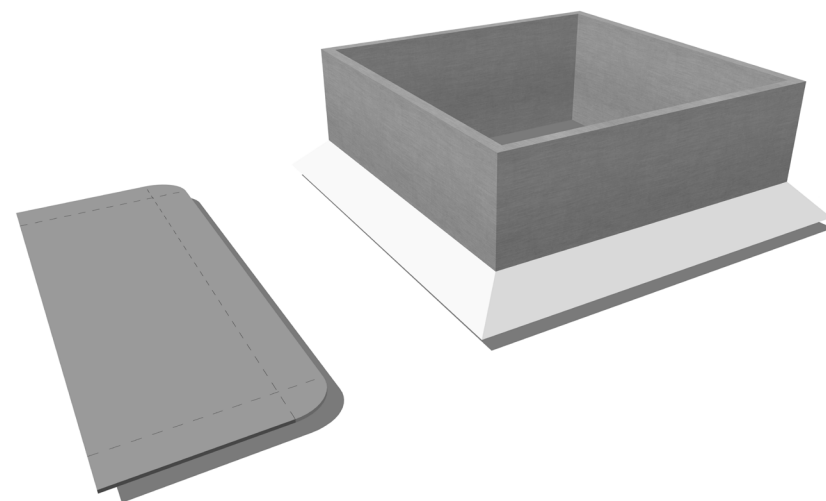


On two opposite sides of the curb cut the membrane flashing and extend minimum of 8" vertically. Make sure it leaves enough section at the base flashing with the membrane overlapping the fasteners and leaving a 1 1/2" minimum weld area. Cut membrane flashing to conform the canted curb base.

# Penetrations and Membrane Repair

## 10.4 CANTED BASE CURB FLASHING (CONTINUED)

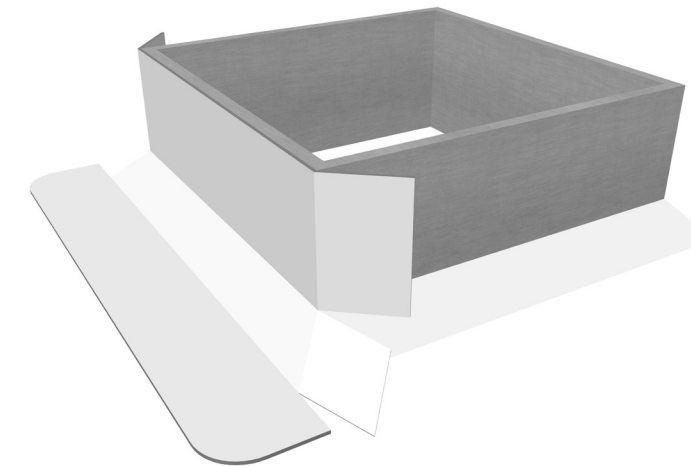


Install the next membrane flashing with 2" lap over the previously installed sheet

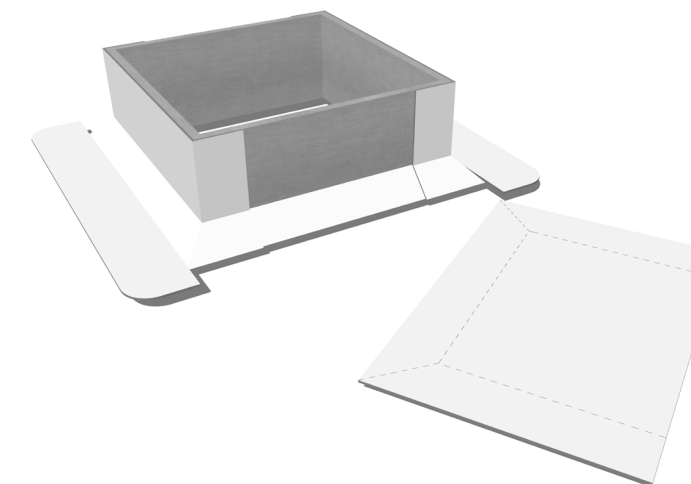


Form membrane to curb as required. The membrane flashing should overlap 2" minimum from the corner. On the remaining two sides, membrane base flashing must be cut to conform to the canted curb base. Miter the corners of the membrane base overlap.

# Penetrations and Membrane Repair

## 10.4 CANTED BASE CURB FLASHING (CONTINUED)

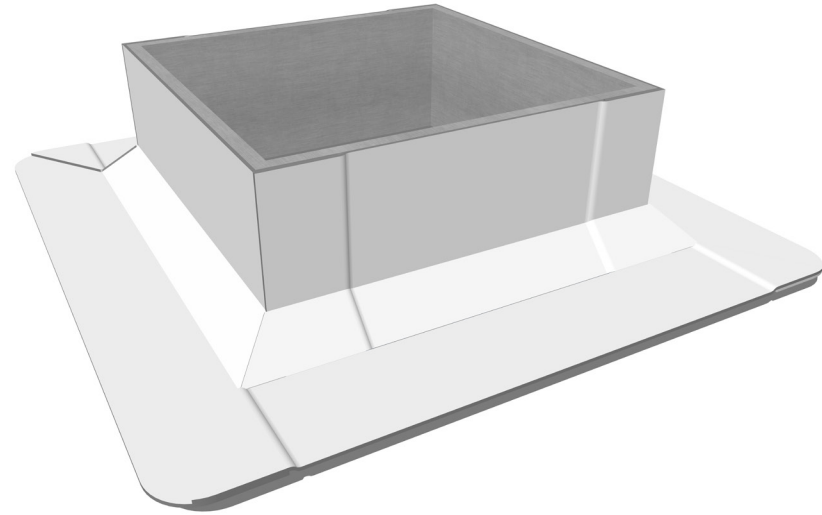


Round the corners of the membrane base overlap (on each side of the corners) and the flashing base overlap (at all ends).

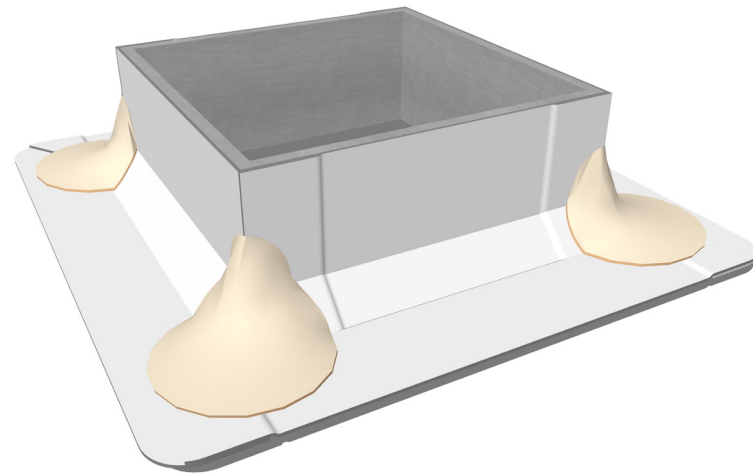


At each corner, weld a universal corner to the membrane flashings with a continuous 1" heat weld. Leave an unwelded area at the center of the corner to allow for movement. Probe all welded seams.

# Penetrations and Membrane Repair

## 10.5 VENT PIPE FLASHING

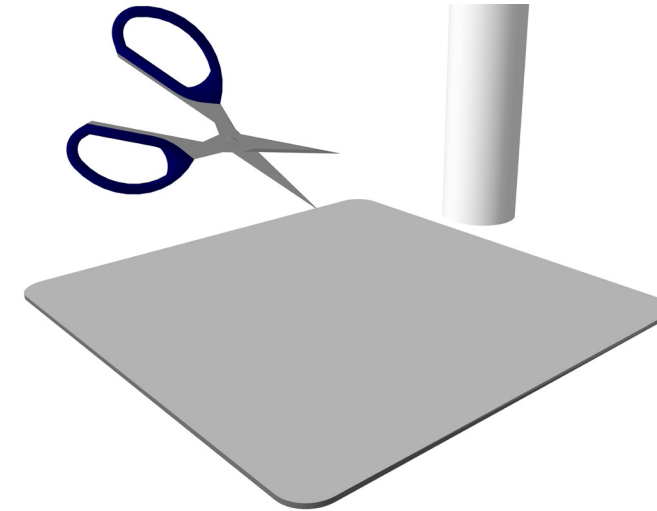

OneDek stretch collar with rounded corners must be used for vent pipe flashing. It should extend a minimum of 4" beyond the fasteners and plates when used.

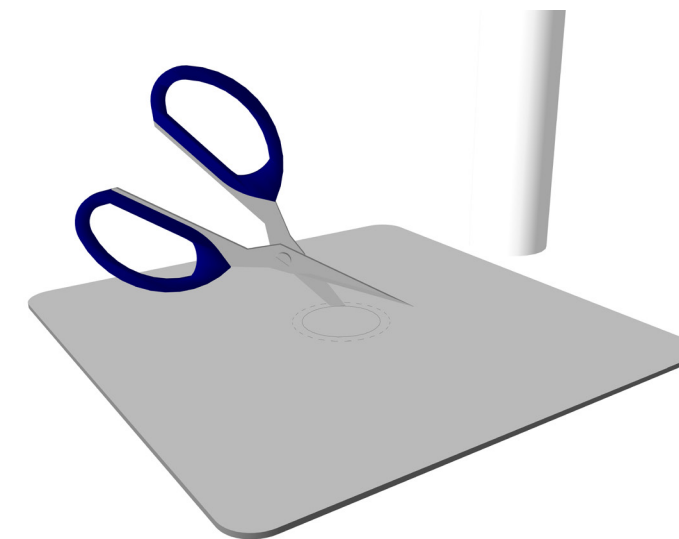


Mark the pipe diameter at the center of the membrane collar. Cut a hole approximately two-thirds of the marked diameter.




# Penetrations and Membrane Repair

## 10.5 VENT PIPE FLASHING (CONTINUED)

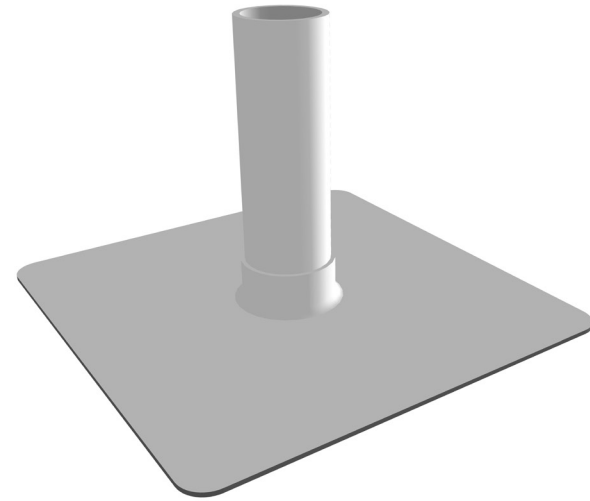

Heat around the stretch collar hole area and stretch fit membrane over the pipe to create a 1" turn-up with the collar seated flush on the field membrane. Use a hand-held hot air welder. Weld the collar continuously to the field sheet.

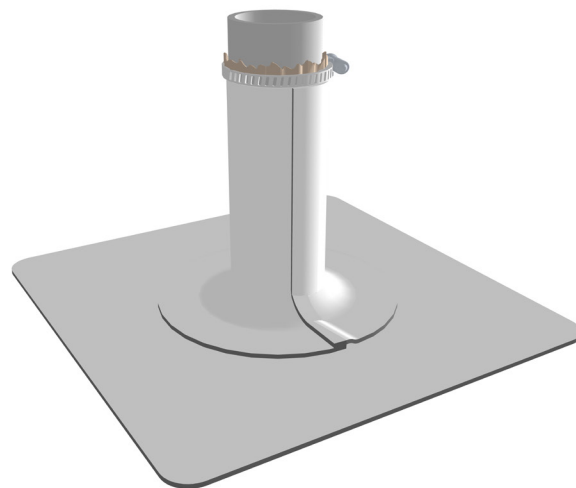


Extend a minimum of 1" weld area at the bottom of the membrane wrap. Adhere the wrap to the pipe. Weld and fuse the bottom of Cut OneDek membrane and wrap it around the pipe. Make sure there is enough weld area at the bottom of the membrane wrap. the wrap with the stretch collar. Overlap and weld the vertical edge of the membrane wrap. Apply sealants behind and around the top of the membrane wrap. Install a draw band at the top of the membrane wrap to avoid water intrusion.

# Penetrations and Membrane Repair


## 10.6 SCUPPER INSTALLATION & FLASHING

Separate scupper body & 3" wide picture frame materials prior to installation. Reserve the picture frame metal safely until after parapet & membrane have been installed. Ensure all parts are present and in good condition before installation. Clean & inspect the scupper opening for debris & proper size.

Install the scupper body from the outside face of the wall by sliding the body through the wall opening. When the scupper is in position, fasten the outside face of the scupper to the wall using appropriate fasteners. Caulk the top edge of the flange to prevent water entry.

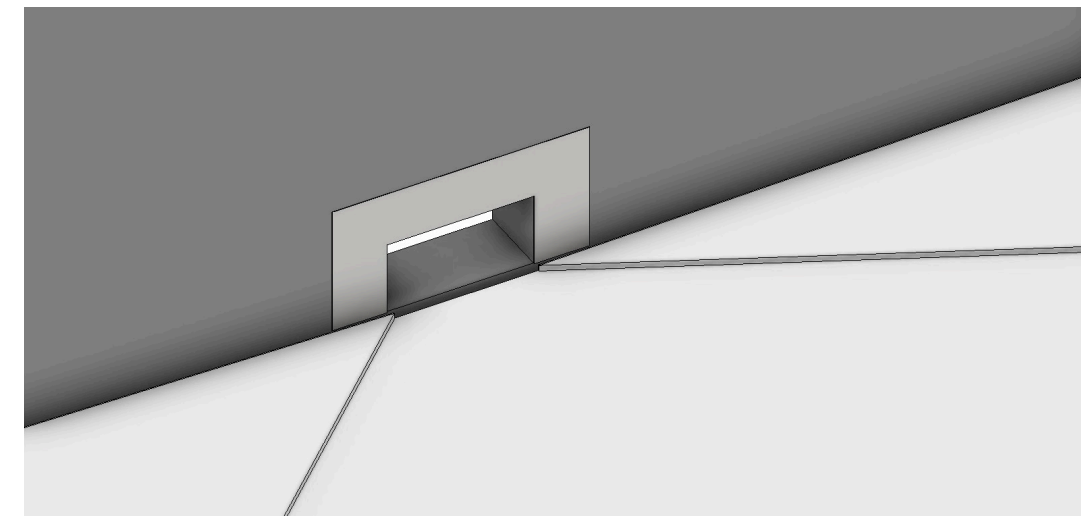

After membrane has been installed to the parapet, install the 3" wide picture frame to the inside face of the wall, laminated side outward, by sliding the frame straight down onto the scupper flush to the inside face of the wall. Fasten the picture frame to the inside wall using appropriate fasteners. Slit the corners of scupper body and seam over onto picture frame. Fasten the scupper body flange to the roof.

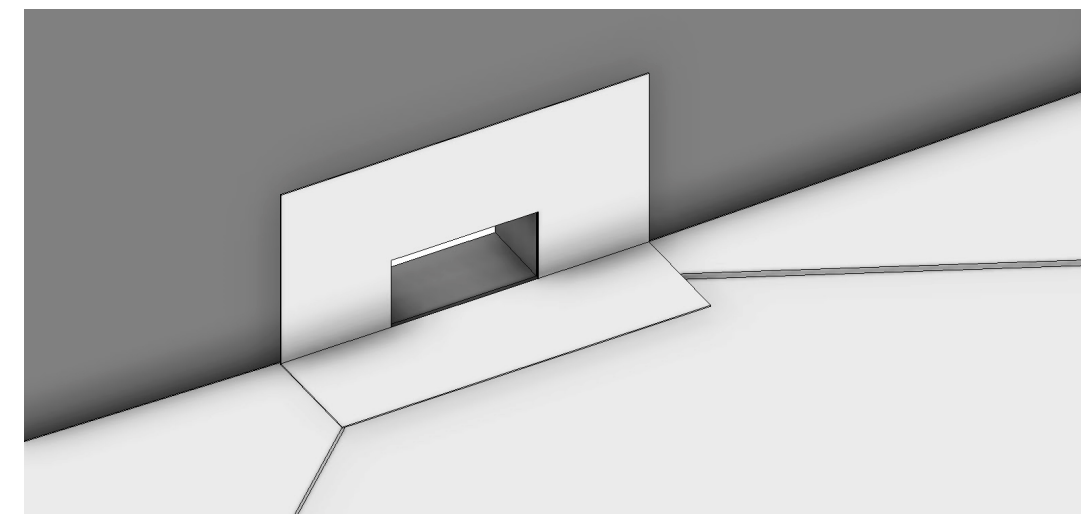

# Penetrations and Membrane Repair

## 10.6 SCUPPER INSTALLATION & FLASHING (CONTINUED)



Cut a rectangular flashing membrane to shape to extend 3" outward on all three sides of the picture frame. Allow 6" of additional width along the roof side and cut out for scupper opening.

Place the flashing at the scupper opening and apply a 1 1/2" continuous weld around the inner edges to secure to the laminated surface of the picture frame. Then apply an additional 1 1/2" continuous weld around the outer surfaces to secure to the parapet & roof membrane.

Caulk around seams & corners of the scupper assembly for proper water seal.

## 10.7 MEMBRANE REPAIR

Cut a rectangular piece of membrane extending 3" or larger in all directions of the repair area. Use the same type of membrane as the field membrane. Make sure that there is at least 1 1/2" weld area around all edges.


Round all corners of the patching membrane.

Ensure area is clean and dry prior to welding process. Use low sudsing soap and water followed by a membrane cleaner to remove dirt, contaminations, grease, oil, etc.


Place the patch at the center of the repair area. Apply a 1 1/2" continuous weld around the edges of the patch to fuse it to the membrane. Probe all welded seams.

# Penetrations and Membrane Repair

## 10.7 INTERNAL DRAIN INSTALLATION & FLASHING (CONTINUED)

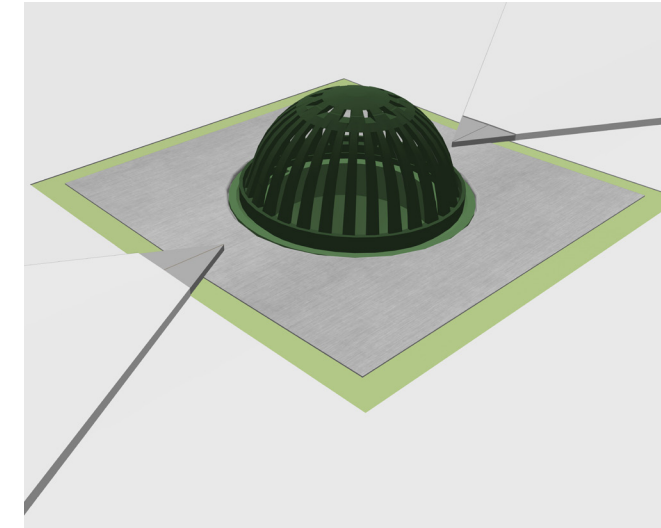

After installation of the drain, cut the membrane away from the interior of the drain for proper drainage.

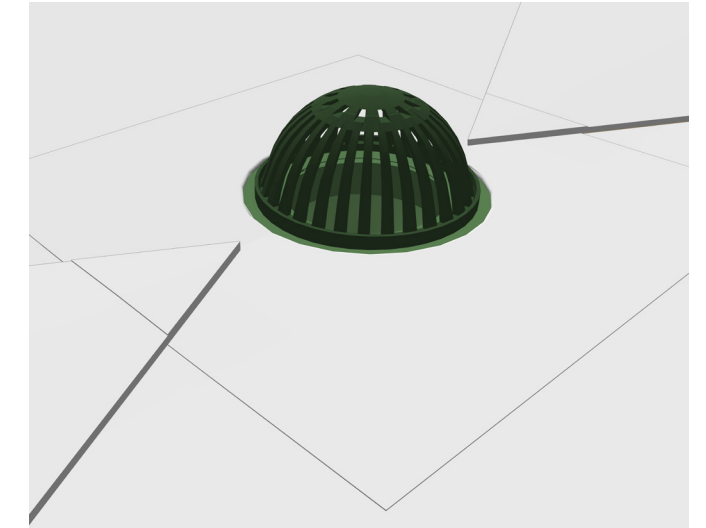

Cut a circular patch of membrane extending 3" or further in all directions of the patch area. Install the remaining drain parts according to manufacturer instructions with the membrane patch and apply a 1 1/2" continuous weld around the edges of the patch to fuse it to the membrane.

## 10.8 MEMBRANE MAINTENANCE

Remove heavy debris that may accumulate over time to prevent drainage issues and organic growth. Ensure drains and scuppers are kept clear. A power washer may be used to loosen dirt and debris. Use low sudsing soap and water followed by membrane cleaner to further remove accumulated dirt and debris. Ensure that runoffs from any detergents used are captured and disposed of properly.



Scan for the most current product information



**All Weather**  
Insulated Panels

1 (888) 970-AWIP (2947)  
[awipanel.com](http://awipanel.com)  
[sales@awipanel.com](mailto:sales@awipanel.com)



In accordance with ongoing efforts to improve our products and their performance, All Weather Insulated Panels reserves the right to change without notice the specifications contained herein. The contents herein are for general information and illustrative purposes only and are not intended to serve as any type of advice. Every effort is made to ensure the accuracy of the information included in this brochure and it is believed that the information contained herein is accurate and reliable as of the date of this publication. All Weather Insulated Panels does not warrant or represent the accuracy or reliability of any information included in this collateral. Any reliance of any information without consultation with All Weather Insulated Panels or a duly authorized representative shall be at the user's own risk. Copyright 2023 All Weather Insulated Panels—All rights reserved.

AWIP|001|11/13/2023